

MR-J3-T

Servo Amplifier

Quick Start Manual

MR-J3-T Servo Amplifier With Point Table Positioning (Point-to-Point Positioning)



About This Manual

If you have any questions about programming or operating the equipment described in this manual please don't hesitate to contact your dealer or one of our official distributors (see back cover).

You can find up-to-date information and answers to frequently-asked questions on our website (www.mitsubishi-automation.com).

MITSUBISHI ELECTRIC EUROPE B.V. reserves the right to make technical changes to the products or this manual at any time without prior notice.

11/2010
MITSUBISHI ELECTRIC EUROPE B.V.

Quick Start Manual
MR-J3-T Servo Amplifier with Integrated Point Table Positioning
Art. No.: xxxxxx

| Version | | | Changes / Additions / Corrections |
|----------------|---------|-----|--|
| A | 10/2007 | pdp | First Edition |
| B | 11/2010 | akl | Section 5.1: Exchange of connection diagram Fig. 5-1 and addition of footnotes |
| | | | |

This Quick Start Manual for the servo amplifiers of the MR-J3-T series with point table positioning is designed to enable you to get your system installed and configured for use as quickly as possible. Please note that this guide only covers the basic functions with the instructions necessary to use these functions. Complete descriptions of all the supported functions and all available extensions can be found in the instruction manuals.

Please also note that the servo amplifiers of the MR-J3-T series include the following additional major functions that are not covered in this Quick Start Manual:

- Communication via a serial port for controlling point table positioning
- Positioning control in BCD format with the optional MR-DS60 digital switch
- Amplifier controller circuit settings and auto-tuning functions

Safety Instructions

To ensure safe and proper installation of the equipment please also observe the instructions and safety precautions in the instruction manuals supplied for your hardware.

Notes in this Quick Start Manual:

NOTE

| Tips and useful information.

Additional documentation:

- MR-J3-T Instruction Manual (SH(NA030061-A))
- MR-J3-T Instruction Manual for CC-Link (SH(NA030058-B))
- Instruction Manual for the CC-Link Master Module:
 - QJ61BT11N
 - A1SJ61BT11
 - A1SJ61QBT11
 - FX2N-16CCL-M

Contents

1 Introduction

| | |
|------------------------|-----|
| 1.1 Preparations | 1-1 |
|------------------------|-----|

2 Installing the Equipment

| | |
|--|-----|
| 2.1 Installing the MR-J3-D01 Extension | 2-3 |
|--|-----|

3 First Functional Test

| | |
|--|------|
| 3.1 Minimum Connections for the Functional Check | 3-5 |
| 3.1.1 Connector pin assignments. | 3-6 |
| 3.2 Functional Test Settings. | 3-7 |
| 3.3 Configuring Positioning Point Tables | 3-9 |
| 3.4 Functional Test with MR Configurator | 3-10 |
| 3.4.1 Selecting point table position entries | 3-10 |

4 Positioning with Digital Inputs

| | |
|---|------|
| 4.1 Additional Connections | 4-11 |
| 4.2 Turning off Automatic Input Signal Activation | 4-14 |
| 4.3 Home Position Return. | 4-15 |
| 4.3.1 Dogless Z-phase reference mode. | 4-15 |
| 4.3.2 Dog mode home position return | 4-19 |
| 4.4 Configuration for Positioning | 4-23 |
| 4.4.1 Importing and exporting point tables. | 4-26 |
| 4.5 Functional Test of Digital Input Positioning | 4-28 |

5 Positioning via a CC-Link Network

| | |
|---|------|
| 5.1 Additional Connections | 5-31 |
| 5.2 CC-Link Communication Settings | 5-34 |
| 5.2.1 Settings on the servo amplifier | 5-34 |
| 5.2.2 Configuration for communication with GX IEC Developer | 5-36 |
| 5.3 Testing the Servo Amplifier via CC-Link | 5-38 |

A Appendix

| | |
|---|------|
| A.1 Digital Signals – Quick Reference. | A-39 |
| A.2 Standard Parameters – Quick Reference | A-40 |
| A.3 Alarms and Warning Messages | A-41 |

1 Introduction

The servo amplifiers of the MR-J3-T series are designed specifically for drive positioning applications using point-to-point positioning without interpolation or trajectory control. The positions to be accessed stored in a table and can be selected cyclically, individually or in any order with:

- Digital signals
- CC-Link communication

The MR Configurator setup software package enables the user to test the entered positioning steps quickly and easily in test mode.

1.1 Preparations

The following products and parts are needed for using the point table positioning features described in this manual:

- A servo amplifier, for example **MR-J3-10T**
- A servo motor compatible with the selected amplifier
Example: **HF-KP13** motor for the MR-J3-10T servo amplifier
- **MRZJW3-SETUP221E Version C0** of the MR Configurator setup software package
- **MR-J3USBCBL3M** USB cable for connecting your PC/notebook with the servo amplifier
- **MR-PWS1CBL□M-A1-L** motor connection cable
- **MR-J3ENCBL□M-A2-L** rotary encoder cable
- **MR-J2CMP2** connector for CN6 I/O signal connector
- Power supply cables conforming to the applicable installation regulations
- Connection cables for the control terminals

Required for positioning control with digital signals:

- **MR-J3CN1** connector for communication connector CN10
- Optional **MR-J3-D01** expansion card

Useful but not absolutely necessary:

- Simulation Box and terminal block with connection cable for testing:
FX Simulation Box (Art. No. 3386)
MR-TB50 terminal block for CN10 (MR-J3-D01)
MR-J2M-CN1TBL□M cable for connecting CN10 to MR-TB50

Required for positioning control via a CC-Link network:

- Q-Rack with PLC and the CC-Link module **QJ61BT11N**
or
A-Rack with PLC and CC-Link module **A1SJ61BT11, A1SJ61QBT11 or FX2N-16CCL-M**
- CC-Link cable compatible with version V1.10 Standard
- Cable for connecting the PC/notebook to the PLC CPU:
Q series: SC-Q QC30R2
A and FX series: SC-09
- The GX IEC Developer programming software package for configuration of the data communications settings

NOTE

This Quick Start Manual describes the installation and setup of a typical servo system consisting of an MR-J3-10T servo amplifier (single-phase, 230V / 100W) and an HF-KP13 servo motor. Note that the specifications of this sample system may differ from those of your configuration – please check your equipment's instruction manuals for details if necessary.

2 Installing the Equipment

The procedure for the physical installation of the MR-J3-T series hardware is exactly the same as for the MR-J3-A and MR-J3-B models. The dimensions of the MR-J3-T series amplifiers are identical to those of the matching models of the MR-J3-A and MR-J3-B series.

NOTE

Please consult the instruction manual for detailed installation instructions.

2.1 Installing the MR-J3-D01 Extension

Procedure:

- ① Remove the cover of the CN7 connector on the right side of the MR-J3-T housing.

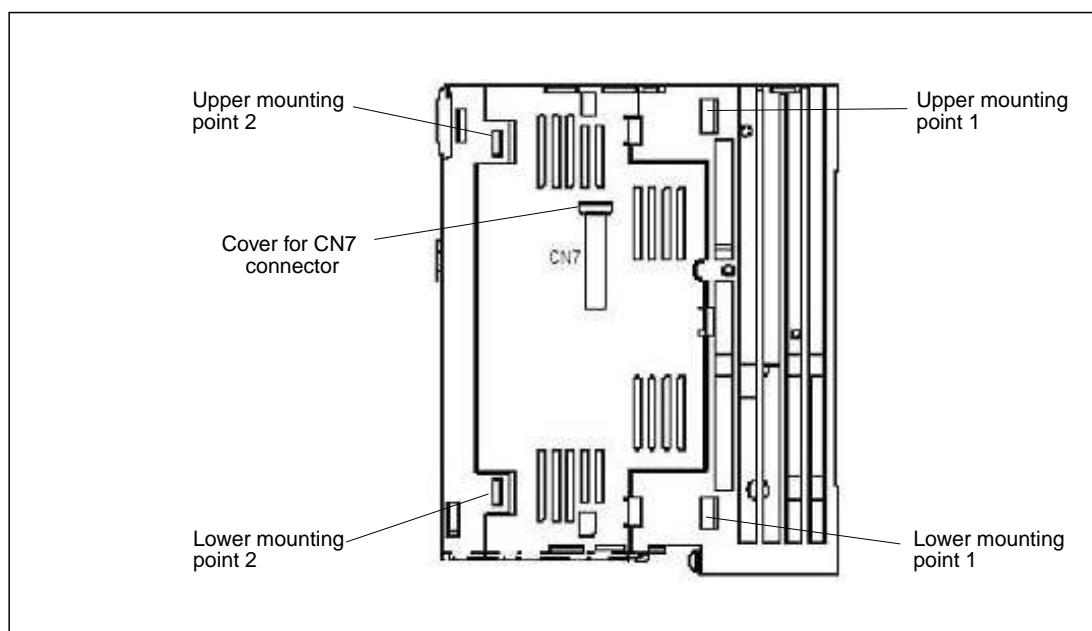


Fig. 2-1: Fixing points of the extension MR-J3-D01

- ② Position the MR-J3-D01 extension over the upper and lower mounting points 1 on the servo amplifier, then press the extension into place so that the lugs click into position in the upper and lower mounting points 2. This also connects the extension to the amplifier via connector CN7 on the amplifier.
- ③ Fasten the extension securely to the servo amplifier with the M4 screw (included) as shown in Fig. 2-2.

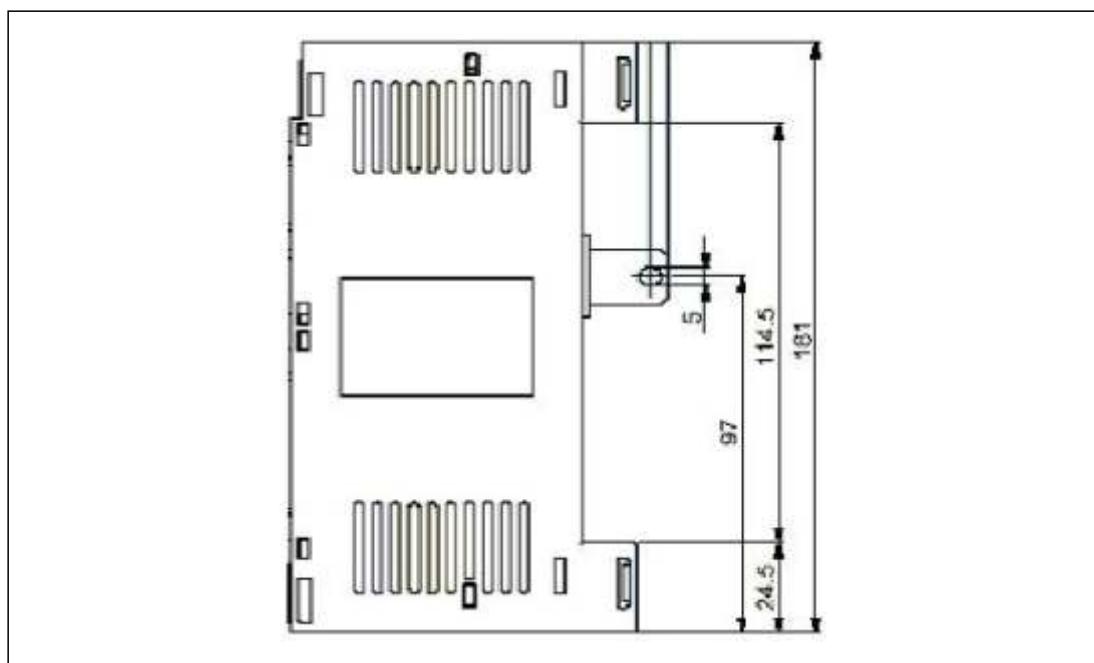


Fig. 2-2: Fastening screw dimensions for extension MR-J3-D01

NOTE

To uninstall the extension perform the above steps in the reverse order. To release the retaining clips press the retaining tabs marked "Push" inwards and pull the extension out to the side.

3 First Functional Test

The wiring diagram below (Fig. 3-1) shows the minimum connections that you must make to test an MR-J3-T series amplifier with the MR Configurator setup software. In test mode you can check whether all the components are working properly.

NOTE

You can also use the optional MR-PRU-03 HMI control terminal for performing initial tests and setting the amplifier's parameters. For further details see the MR-J3-T series instruction manual.

3.1 Minimum Connections for the Functional Check

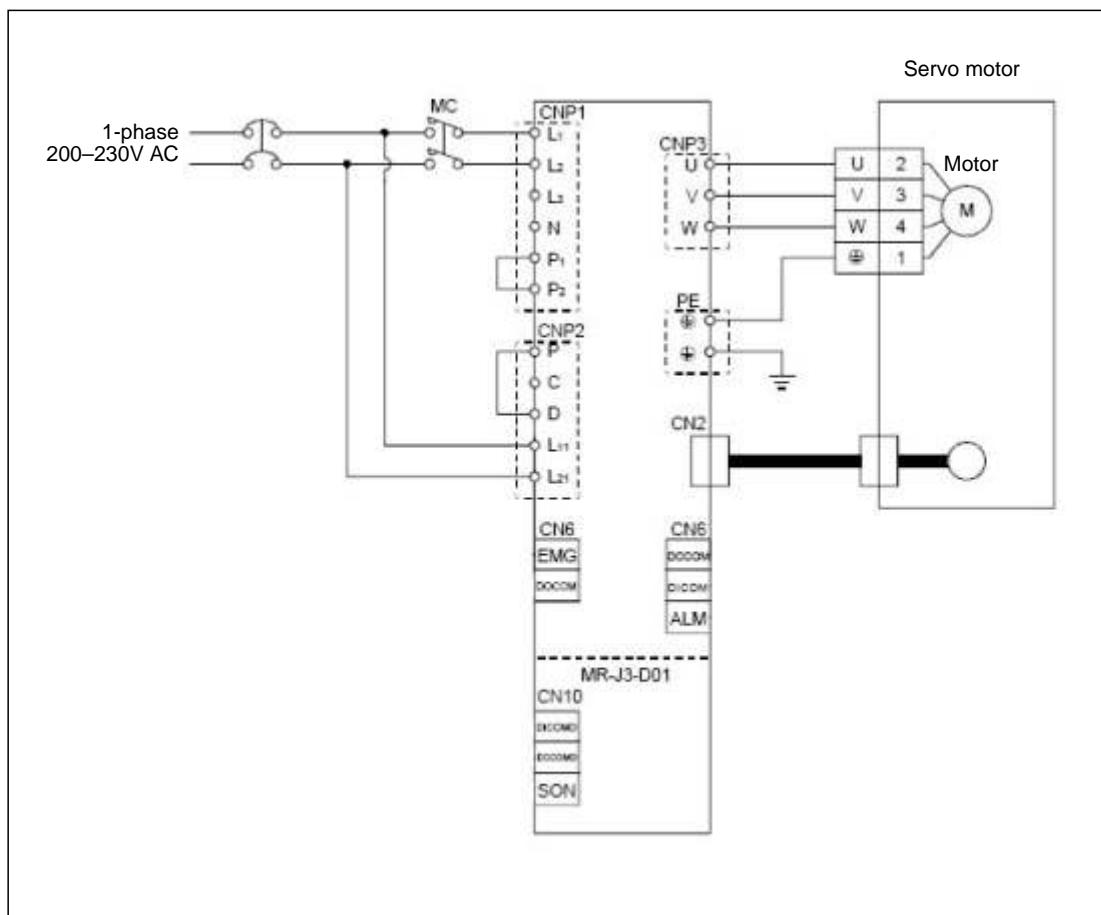


Fig. 3-1: Wiring diagram for minimum configuration without control terminals

3.1.1 Connector pin assignments

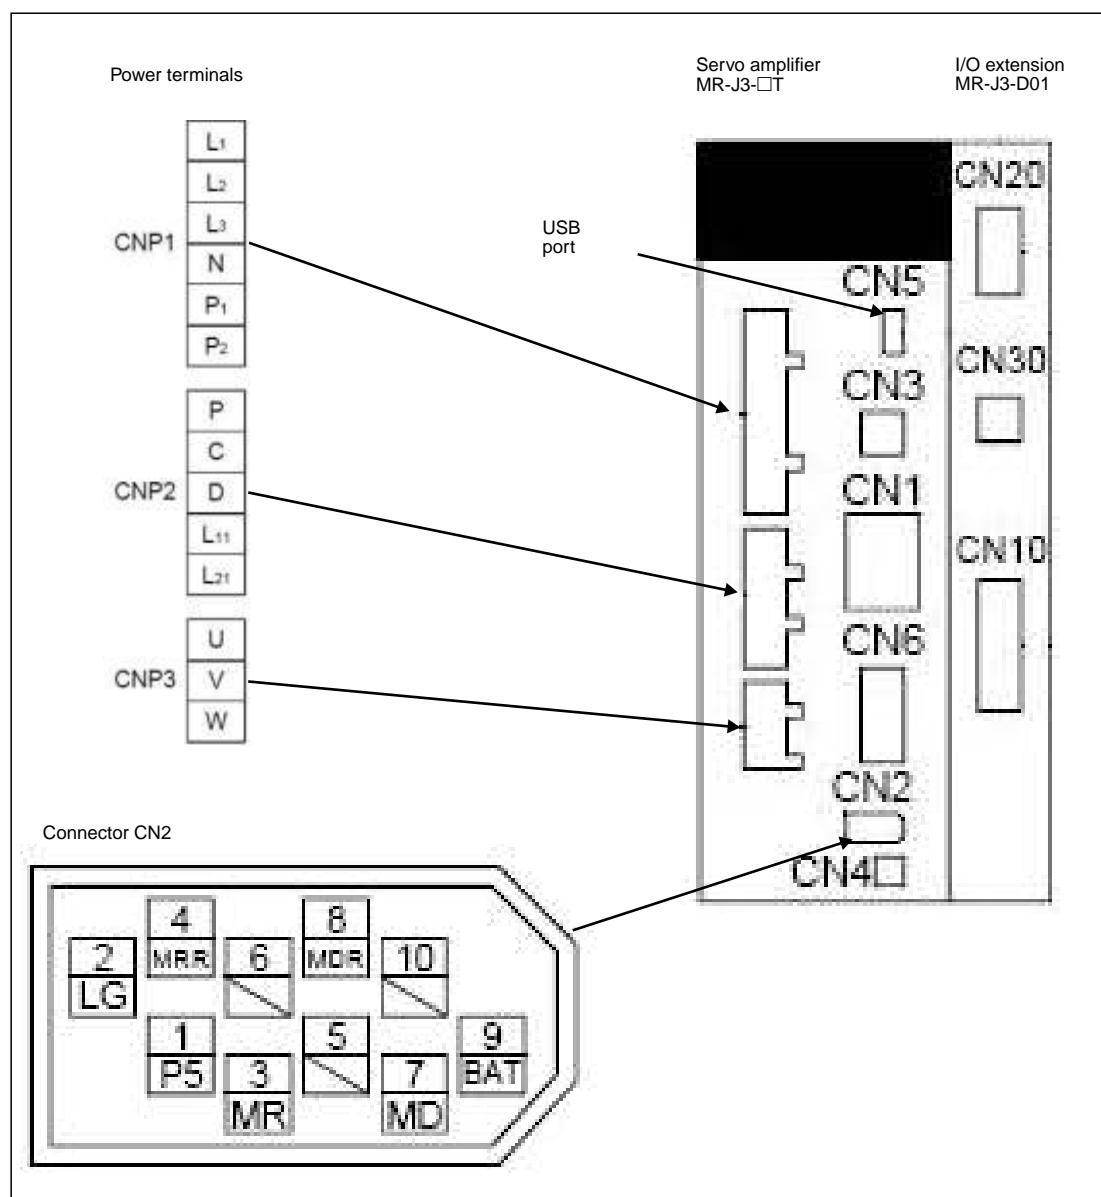


Fig. 3-2: Power and control connector pin assignments for minimum configuration

3.2 Functional Test Settings

The following input signals are required to activate the servo amplifier's motor output:

- EMG -> Force stop (safety signal)
- SON -> Servo ON
- LSP -> Forward rotation stroke end (limit switch)
- LSN -> Reverse rotation stroke end (limit switch)

You can configure the servo amplifier to activate these signals automatically when the power is switched on:

Procedure:

- ① Connect the PC / notebook to the servo amplifier's USB port (CN5) with the MR-J3USBCBL3M cable.
- ② Start MR Configurator on the computer and make the following settings:
 - Select the MR-J3-T series servo amplifier:

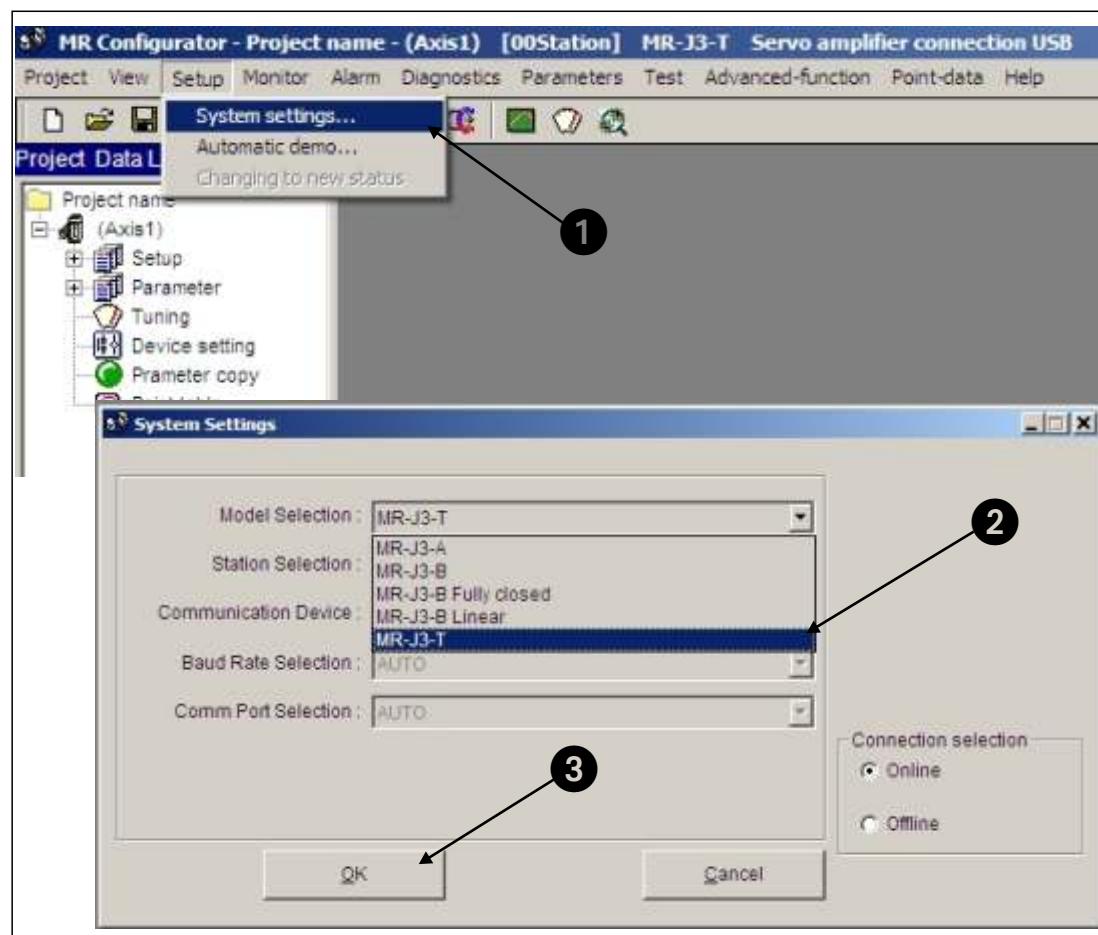


Fig. 3-3: Selecting the servo amplifier

- Set the parameter for the automatic activation of the EMG, SON and LSP/LSN input signals:

Parameter PD01 “Input signal automatic ON selection 1” = 1C04

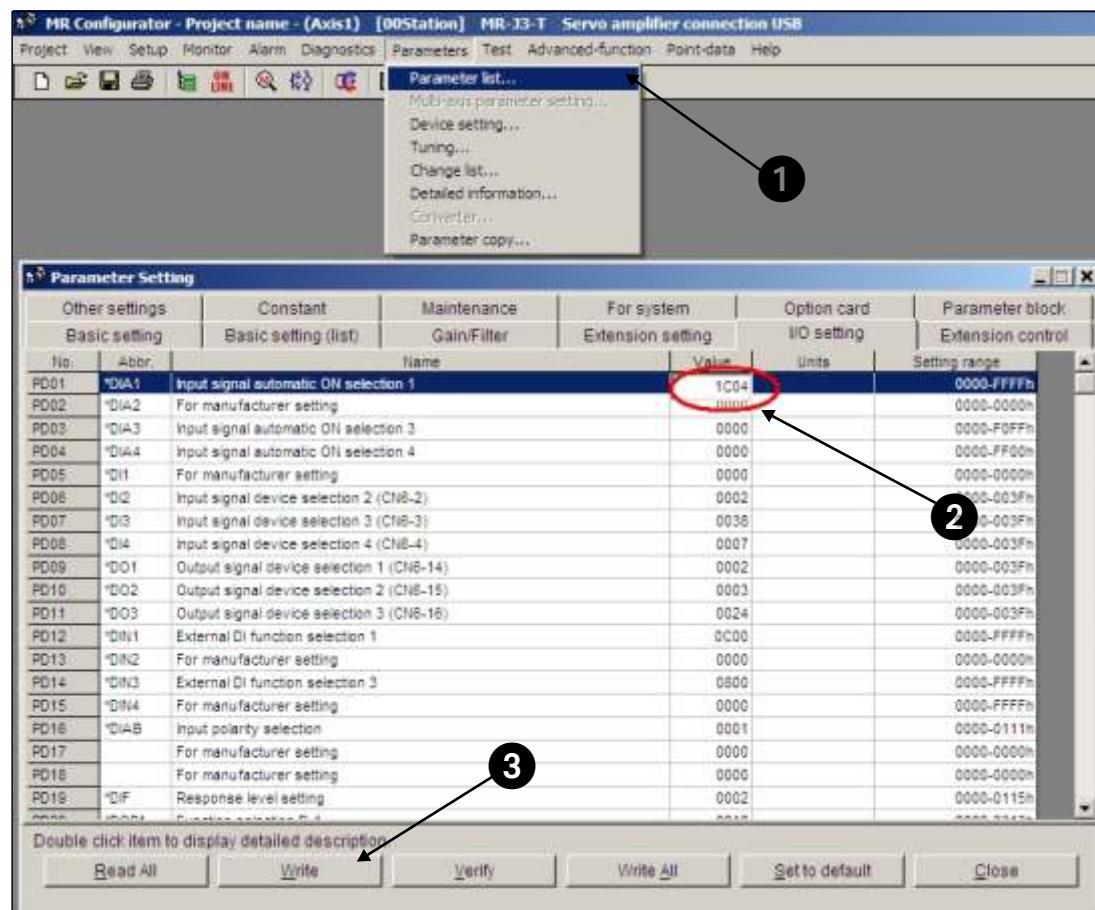


Fig. 3-4: Parameter settings for automatic input signal activation.

- Turn the servo amplifier off and then turn it on again to initialise the new parameter setting.

3.3 Configuring Positioning Point Tables

The position values, travel speeds and acceleration and deceleration times are stored in tables known as “point tables”. We will now go through the steps required to configure and define a point table.

Procedure:

- ① Select the *Point Table* option from the *Point-data* menu.
- ② Enter the values for the movements (position, speed, acceleration and deceleration times) in the *Point Table List* window, using one line for each movement:
 - Enter target position **(a)** in $\mu\text{m} \times 10^{\text{STM}}$ (STM: e in diagram).
 - Enter speed **(b)** in rpm.
 - Enter acceleration/deceleration times **(c)** and **(d)** in ms as required for the motor’s rated speed.
- ③ Save the entries by clicking on the *Write All* button.

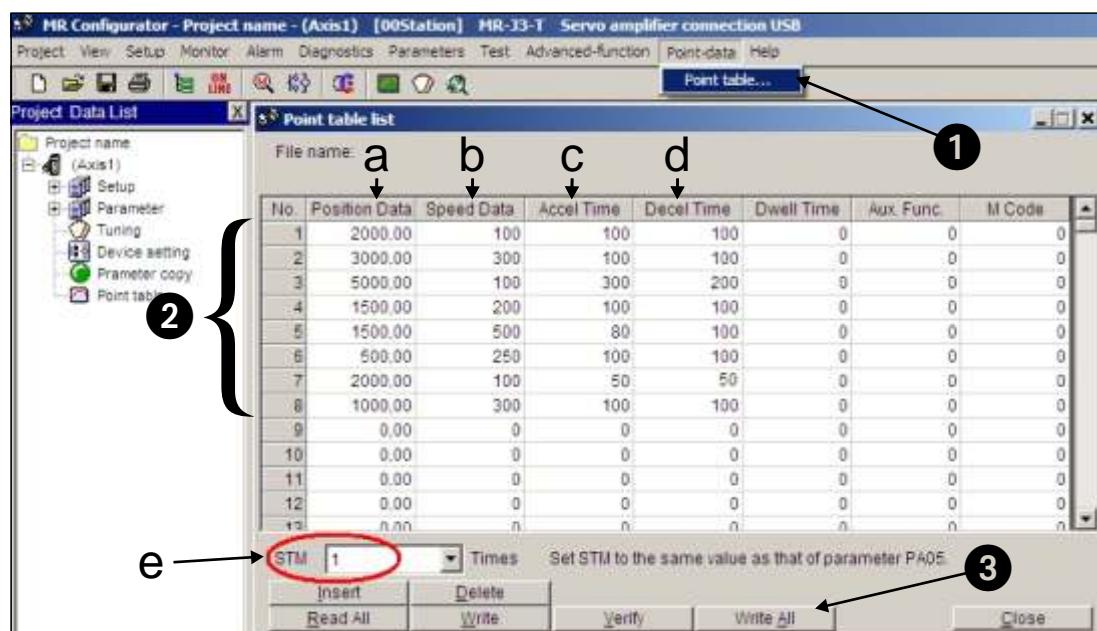


Fig. 3-5: Point table positioning entries in the point table list window

Make sure that the *Aux. Func.* value in every line is left at the default factory setting (“0”) to ensure that selecting a position value in the table does not inadvertently activate any subsequent table entries.

NOTES

In the factory default settings the absolute value command system for the target positions is activated with parameter PA01 “*STY”. When this system is active all target position values are referred to the physical home position. Alternatively you can also select the incremental value command system. The absolute position detection system for the home return function can be set with parameter PA03 “*ABS” (see chapter 4.3).

| Loading the factory defaults will not overwrite your point table entries.

3.4 Functional Test with MR Configurator

Using MR Configurator you can perform a basic test of the individual positioning steps and make adjustments for your application. Note that setting parameter **PA14** does not have any effect on the rotation direction in **jog mode** when using MR Configurator. The rotation directions are defined as follows, looking at the end of the drive shaft (i.e. towards the motor):

- FORWARD -> anticlockwise
- REVERSE -> clockwise

NOTES

- | Home position return is not possible in test mode when using MR Configurator – use the **jog function** to move to the starting position.
- | You can set the rotation direction in “single-step feed mode” with parameter **PA14**.

3.4.1 Selecting point table position entries

Procedure:

- ① Select Single-step Feed ① in the *Test* menu.
- ② To select a position enter its point table line number in the dialog box displayed ②.
- ③ Start the positioning operation ③.

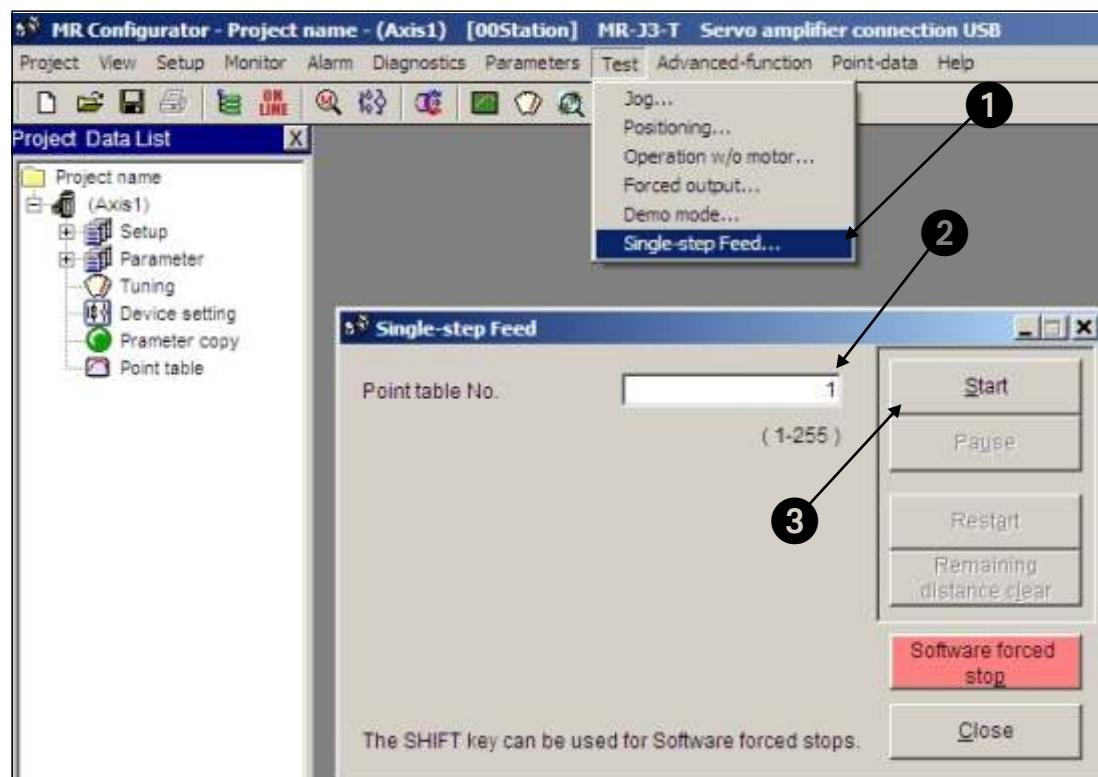


Fig. 3-6: Single-step Feed window for testing individual positioning steps

4 Positioning with Digital Inputs

This chapter describes how point table positioning is used in most applications with the MR-J3-T series amplifiers and the **MR-J3-D01** I/O extension.

NOTE

Please refer to the instruction manual if you need other functions other than those described here for your application.

4.1 Additional Connections

The initial functional tests described in chapter 3.1 were performed with a minimum connection configuration. For the full range of standard functions you now need to make additional power supply and control terminal connections on the CN6 and CN10 terminal blocks, as shown below in Figs. 4-1 and 4-2.

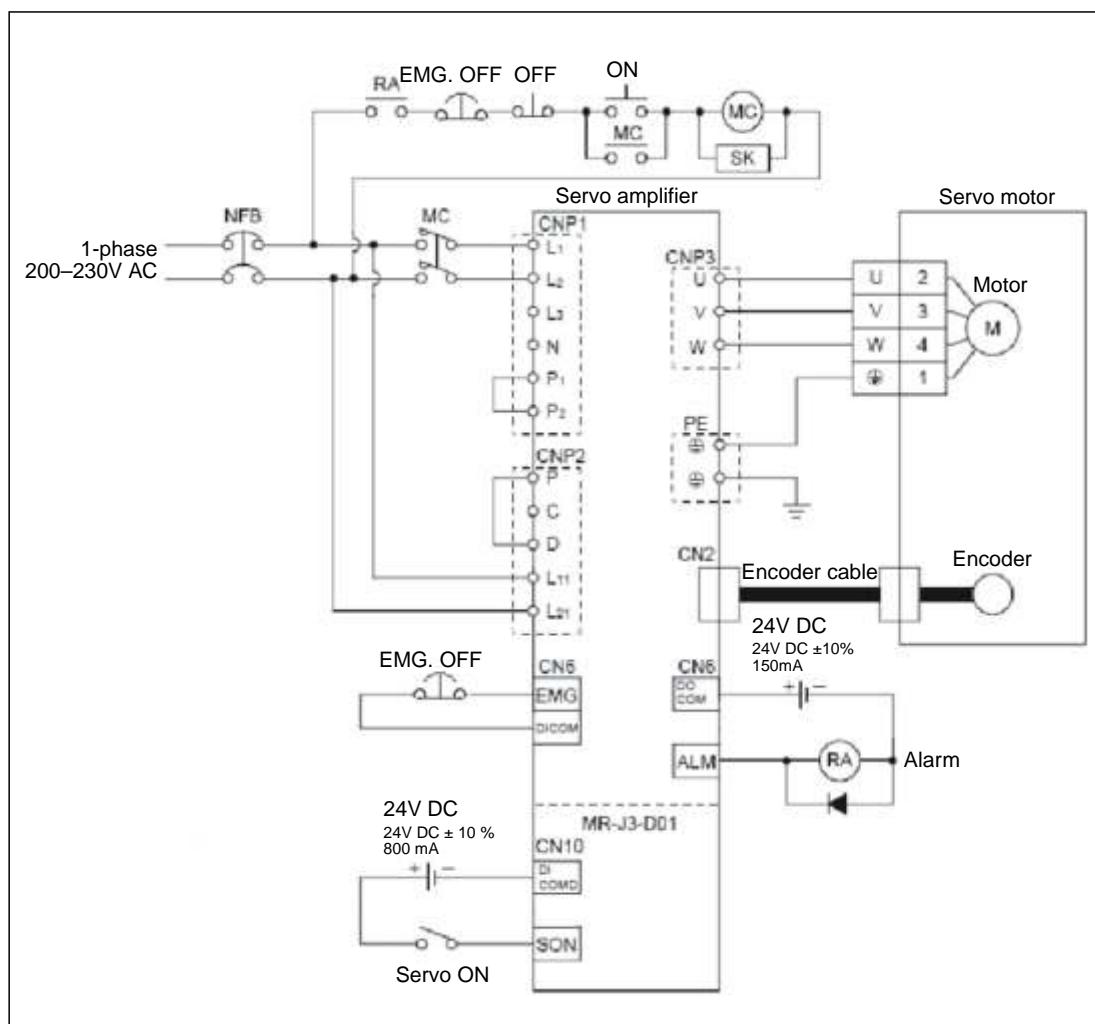


Fig. 4-1: Single-phase power connections for the MR-J3-T amplifier

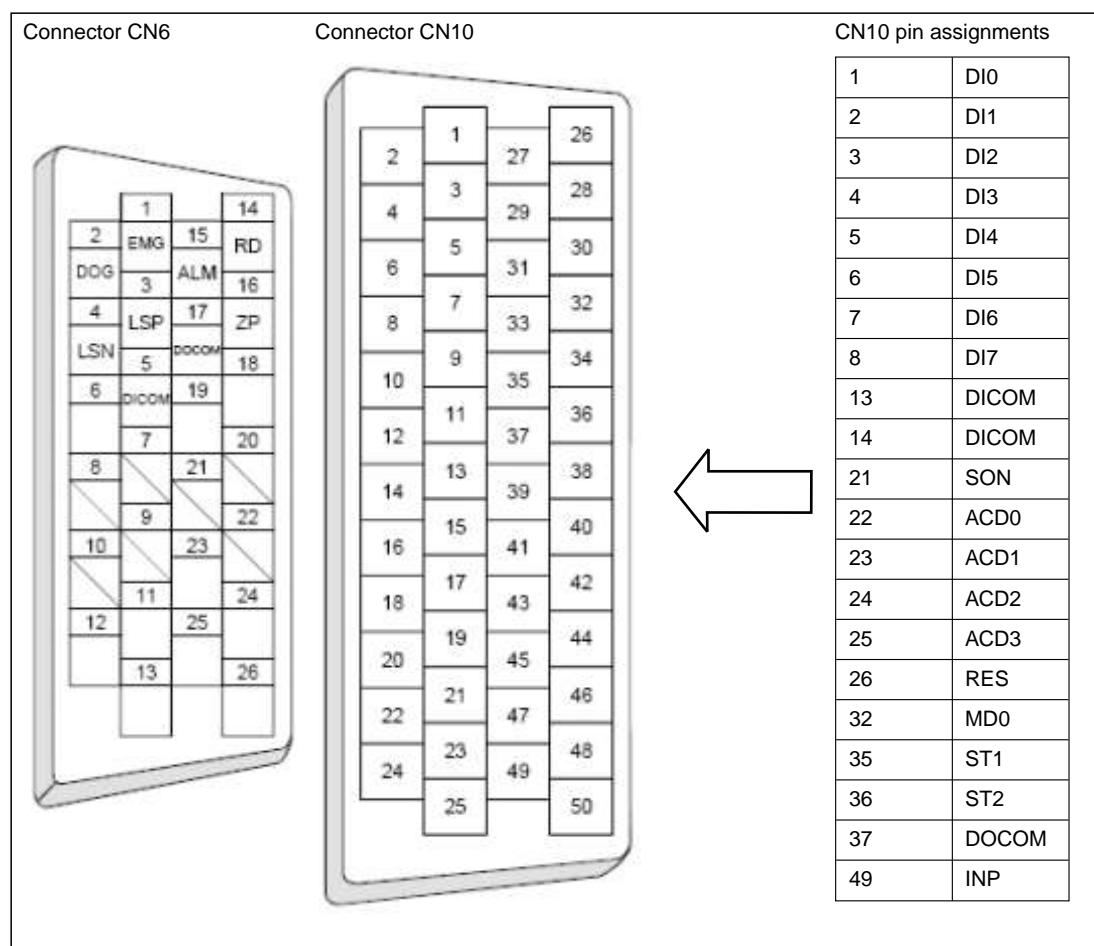


Fig. 4-2: Pin assignments of connectors CN6 and CN10

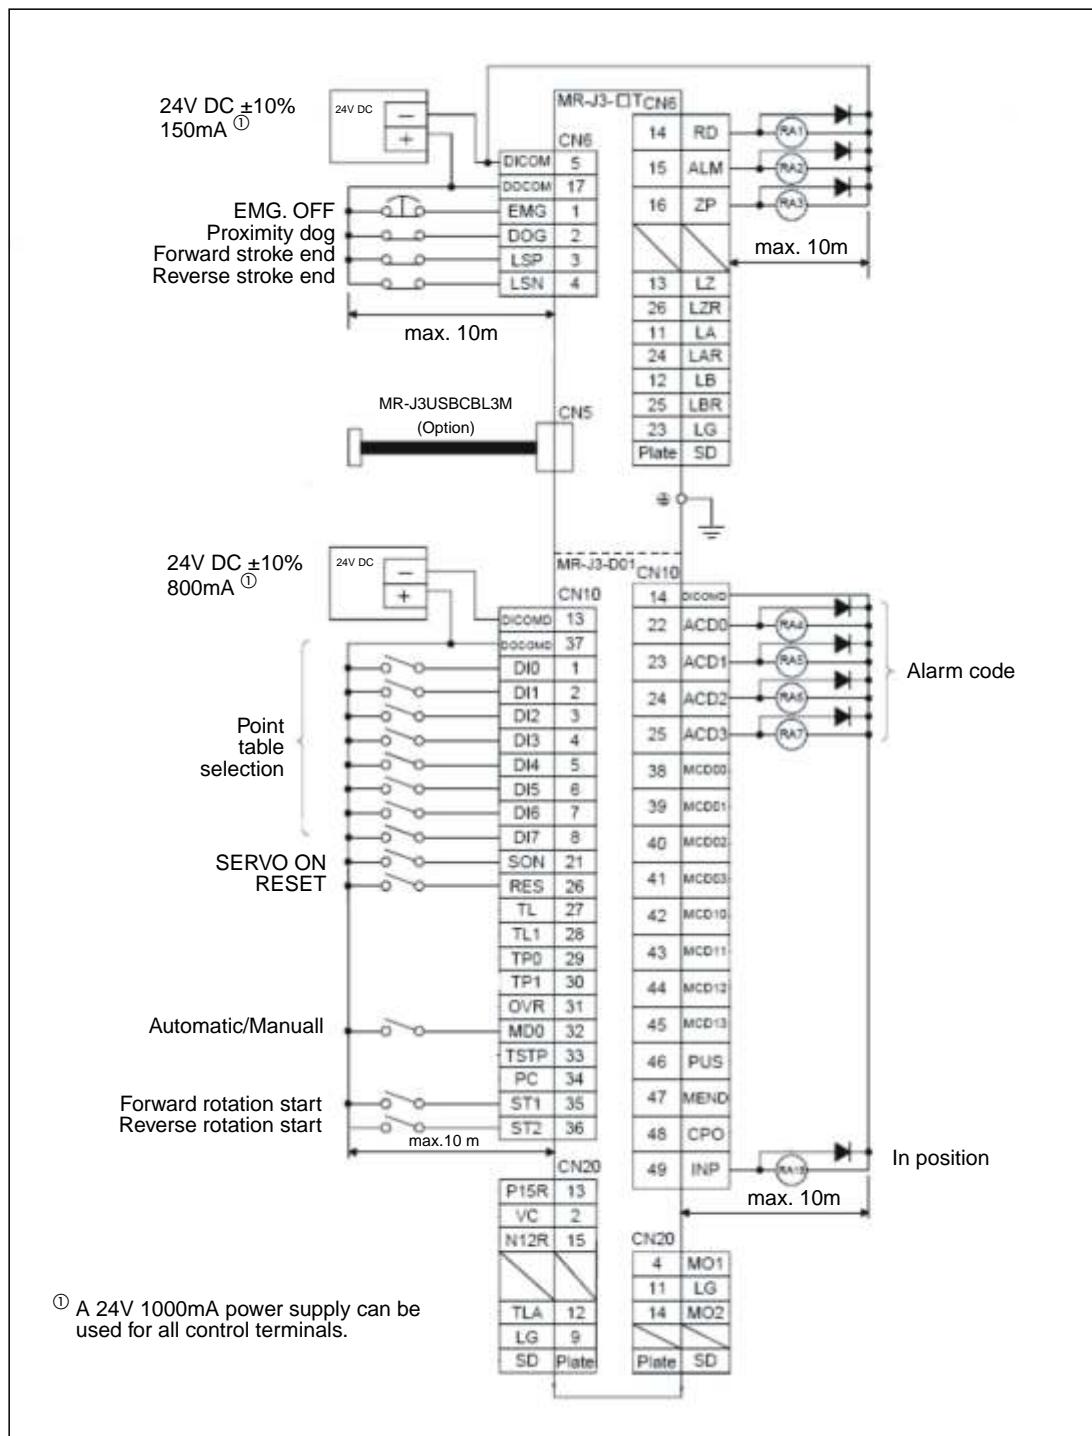


Fig. 4-3: Connection of the control terminals with PNP logic (source logic)

NOTES

You can find a brief descriptions of the signal functions in Appendix A.1. Please refer to the instruction manual for a complete reference.

All digital signals described in this manual use source logic.

For safety reasons the EMG signal must be connected to pin 1 of connector CN6 if the servo amplifier is not operated during the first functional test. The EMG signal is permanently assigned to pin 1 and the amplifier is deactivated when there is no EMG signal if it is configured accordingly (see chapter 3.2).

4.2 Turning off Automatic Input Signal Activation

Procedure:

- ① Reset parameter **PD01** to a value of "0":


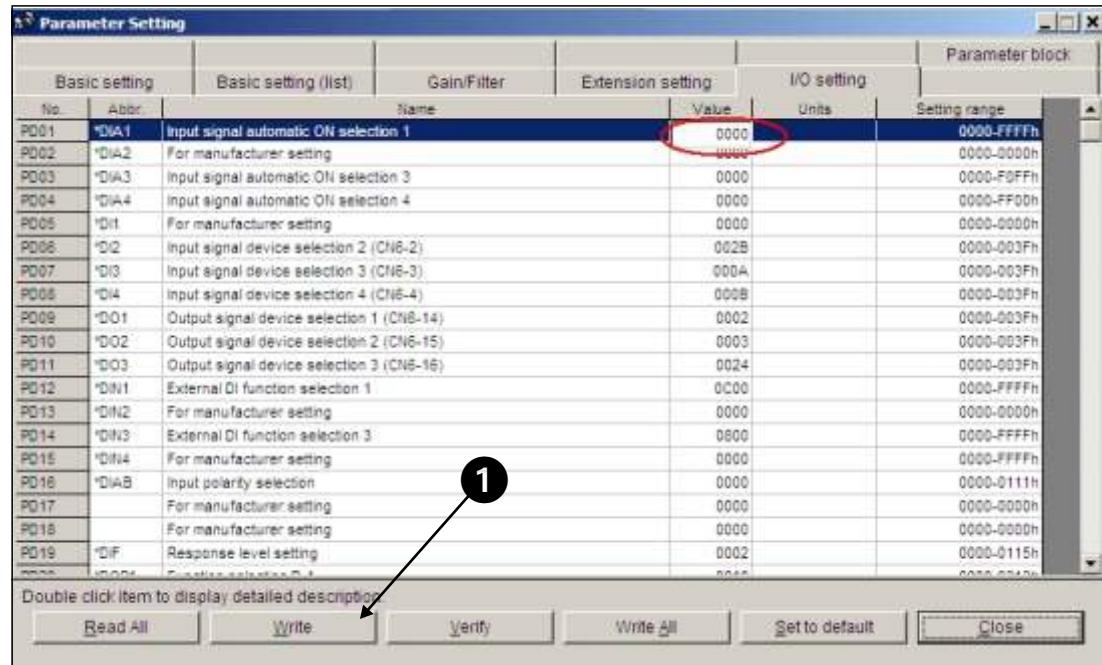


Fig. 4-4: Switching off automatic input signal activation

4.3 Home Position Return

At the factory the MR-J3-T servo amplifiers are configured with the incremental system activated by default (i.e. the absolute position detection system is switched off). This means that the current position is not stored when the amplifier's power supply is switched off, making it necessary to perform a return to home position every time the unit is powered up. You can configure the home position return mode with Parameter **PC02**:

Parameter PC02

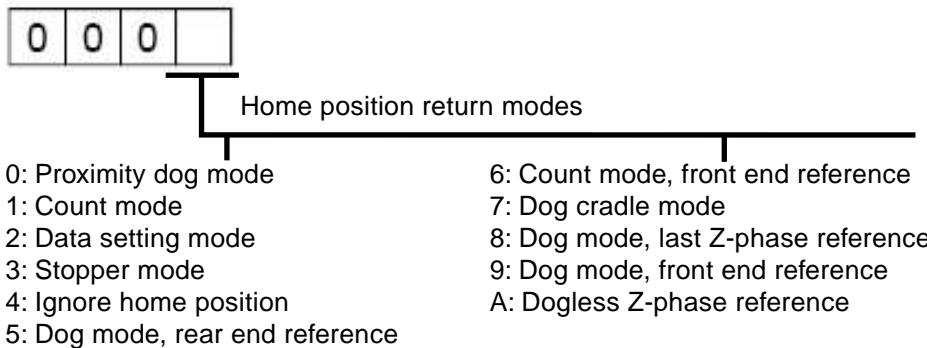

The most commonly used modes are:

- 1. Dogless Z-phase reference mode (A)**
- 2. Proximity dog mode (0)**

These two modes are described in detail below. Dogless Z-phase reference mode is suitable for simple applications. Dog mode is frequently used for standard applications.


4.3.1 Dogless Z-phase reference mode

In this mode the Z-phase of the rotary encoder (zero position of the encoder) is used as the machine's physical home position. However, it is quite rare to be able to configure a machine so that its physical home position exactly matches the Z-phase of the encoder. It is thus almost always necessary to enter an offset (shift) with parameter **PC06**.

After activation of the forward start command ST1 (or reverse ST2) the home position return is initiated by parameter **PC04** ("home position return speed"). When the Z-phase signal from the encoder is registered the servo motor brakes to a halt. After this a precise return to home is performed at creep speed with parameter **PC05**.

The physical home position can be shifted in relation to the zero position of the encoder (Z-phase) with the home position offset (shift) defined with parameter **PC06**. Parameter **PC07** can be used to define a home position value other than zero.

When the home position return has been completed successfully the servo amplifier activates the ZP signal.

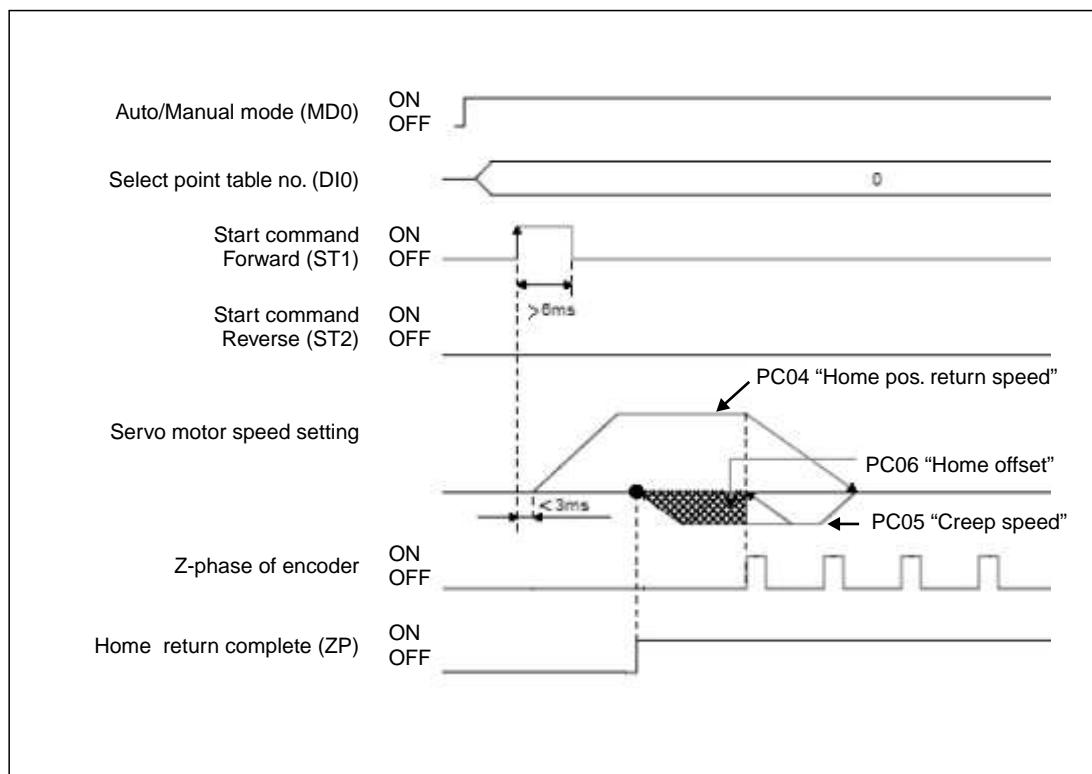Timing chart:**Fig. 4-5:** Home position return sequence in dogless Z-phase reference mode

| No. | Code | Function | Description |
|-------------------|-------|-------------------------------------|---|
| PA05 ^① | *FTY | Feed length multiplication factor | Needed here to scale the home position value to the physical coordinate system. |
| PC02 ^① | *ZTY | Home position return mode | Selects the home position return mode: A: Dogless Z-phase reference mode |
| PC03 ^① | *ZDIR | Home position return direction | 0: Incrementing counting of encoder pulses 1: Decrementing counting of encoder pulses |
| PC04 | ZRF | Home position return speed | Sets home position return speed until first detection of the Z-phase in [rpm]. |
| PC05 | CRF | Creep speed | Speed for precise movement to home position in [rpm]. |
| PC06 | ZST | Home position offset (shift) | Distance between the encoder zero point (Z-phase) and the physical home position in [μm]. |
| PC07 ^① | *ZPS | Home position return position value | The home position return stops when the Z-phase position is reached. You can enter a non-zero coordinate for this position [in $10^{\text{STM}} \mu\text{m}$] with this parameter. |

Table 4-1: Parameter reference table

^① You must turn the power off and on again to activate this parameter.

Examples:

- ① The Z-phase of the encoder is defined as the physical home position of the machine. In this example we are going to perform the home position return at 200 rpm in the direction in which the encoder pulses are counted incrementally.

Parameter settings:

| No | Name | Value | Units | Setting range |
|------|-------|-------|-------------------------|---------------|
| PC01 | *GID | 0000 | 0000-0002h | |
| PC02 | *ZTY | 000A | 0000-000Ah | |
| PC03 | *ZDIR | 0000 | 0000-0001h | |
| PC04 | ZRF | 200 | r/min | 0-50000 |
| PC05 | CRF | 20 | r/min | 0-50000 |
| PC06 | ZST | 0 | μm | 0-65535 |
| PC07 | *ZPS | 0 | 10 ⁻⁵ MMum | -32768-32767 |
| PC08 | DCT | 0 | 10 ⁻⁵ STMMum | 0-65535 |
| PC09 | ZTM | 100 | ms | 5-1000 |
| PC10 | ZTT | 10 | ms | 1-100.0 |
| PC11 | CRP | 0 | ms | 0-65535 |
| PC12 | JOG | 0 | ms | 0-50000 |
| PC13 | *STC | 0 | ms | 0-1000 |
| PC14 | *BKC | 0 | pulse | 0-32000 |
| PC15 | QRP | 0000 | 0000-0001h | |
| PC16 | MBR | 100 | ms | 0-1000 |
| PC17 | ZSP | 50 | r/min | 0-10000 |
| PC18 | *BPS | 0000 | 0000-0001h | |
| PC19 | *EIRS | 0000 | 0000-0021h | |
| PC20 | *CIO | 0 | ms | 0-1000 |

Fig. 4-6: Relevant parameter settings for example 1

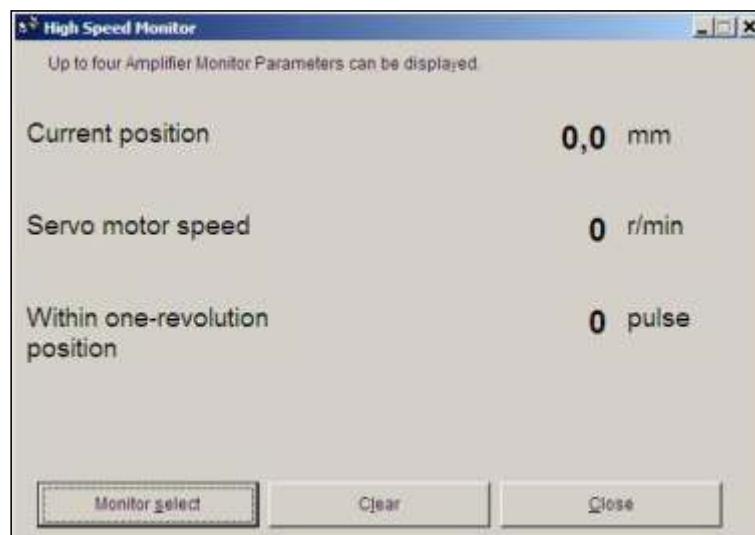


Fig. 4-7: Values shown when the home position return has been completed correctly

- ② Perform a home position return as in example 1 but with an offset between the physical and encoder home positions, set with parameter PC06.

Parameter settings:

| Basic setting | | Basic setting (list) | | Gain/Filter | | Extension setting | | I/O setting | | Parameter block | |
|---------------|-------|--|--|-------------|--|-------------------|----------|-------------|--|-----------------|--|
| No. | Abbr. | Name | | | | Value | Units | | | Setting range | |
| PC01 | 'OMD | For manufacturer setting | | | | none | | | | 0000-0002h | |
| PC02 | 'ZTY | Home position return type | | | | 0004 | | | | 0000-000Ah | |
| PC03 | 'ZDR | Home position return direction | | | | 0000 | | | | 0000-0001h | |
| PC04 | ZRF | Home position return speed | | | | 200 | r/min | | | 0-50000 | |
| PC05 | CRF | Creep speed | | | | 20 | r/min | | | 0-50000 | |
| PC06 | ZST | Home position shift distance | | | | 3000 | um | | | 0-65535 | |
| PC07 | 'ZPS | Home position return position data | | | | 0 | 10'sTlum | | | -32768-32767 | |
| PC08 | DCT | Moving distance after proximity dog | | | | 0 | 10'sTlum | | | 0-65535 | |
| PC09 | ZTM | Stopper type home position return stopper time | | | | 100 | ms | | | 5-1000 | |
| PC10 | ZTT | Stopper type home position return torque limit value | | | | 15.0 | % | | | 1.0-100.0 | |
| PC11 | CRP | Rough match output range | | | | ±10'sTlum | | | | 0-65535 | |
| PC12 | JOG | Jog speed | | | | 0 | pulse | | | 0-50000 | |
| PC13 | 'STC | S-pattern acceleration/deceleration time constant | | | | 0000 | | | | 0-1000 | |
| PC14 | 'BKC | Backlash compensation | | | | 0 | | | | 0-32000 | |
| PC15 | ORP | For manufacturer setting | | | | 0000 | | | | 0000-0001h | |
| PC16 | MBR | Electromagnetic brake sequence output | | | | 100 | ms | | | 0-1000 | |
| PC17 | ZSP | Zero speed | | | | 50 | r/min | | | 0-10000 | |
| PC18 | 'BPS | Alarm history clear | | | | 0000 | | | | 0000-0001h | |
| PC19 | 'ENRS | Encoder output pulse selection | | | | 0000 | | | | 0000-0021h | |
| PC20 | 'ENUS | Encoder unit selection | | | | 0000 | | | | 0-1 | |

Double click item to display detailed description.

Read All Write Verify Write All Set to default Close

Fig. 4-8: Relevant parameter settings for example 2. The offset is entered with parameter PC06.

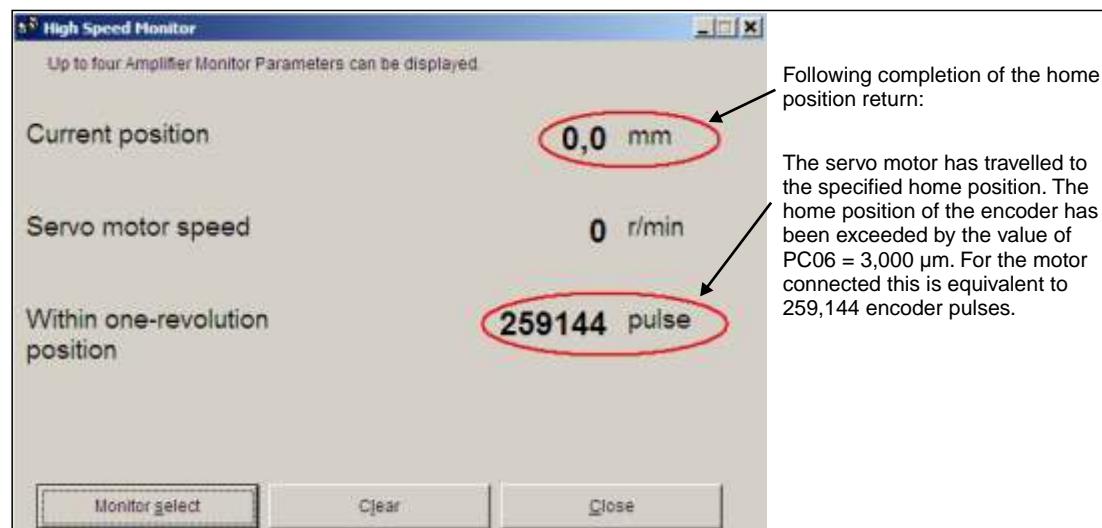


Fig. 4-9: Values shown when the home position return has been completed correctly

4.3.2 Dog mode home position return

In this mode, instead of the encoder Z-phase(Fig. 4-6), the DOG signal is used to switch from "home position return speed" **PC04** to "creep speed" **PC05**. You can use parameter **PD16** "proximity dog detection polarity" to specify whether a logical "1" or a logical "0" should be identified as an active DOG signal.

As in ① above, the physical home position can be shifted in relation to the home (zero) position of the encoder (Z-phase) with **PC06** "home position offset (shift)". In addition to this you can also set a non-zero coordinate for the home position with **PC07**.

Conditions for the proximity dog signal:

The proximity dog signal (DOG) must fulfill the following conditions to ensure that the Z-phase of the encoder is detected during the activation period of the DOG signal:

$$L_1 \geq \frac{V}{60} \cdot \frac{t_d}{2}$$

L1 = Length of the DOG signal in [mm]


V = Home position return speed in [mm/min]

t_d = Deceleration time in [s]

$$L_2 \geq 2 \cdot \Delta S$$

L2 = Length of the DOG signal in [mm]

ΔS = Distance for one rotation of the motor in [mm]

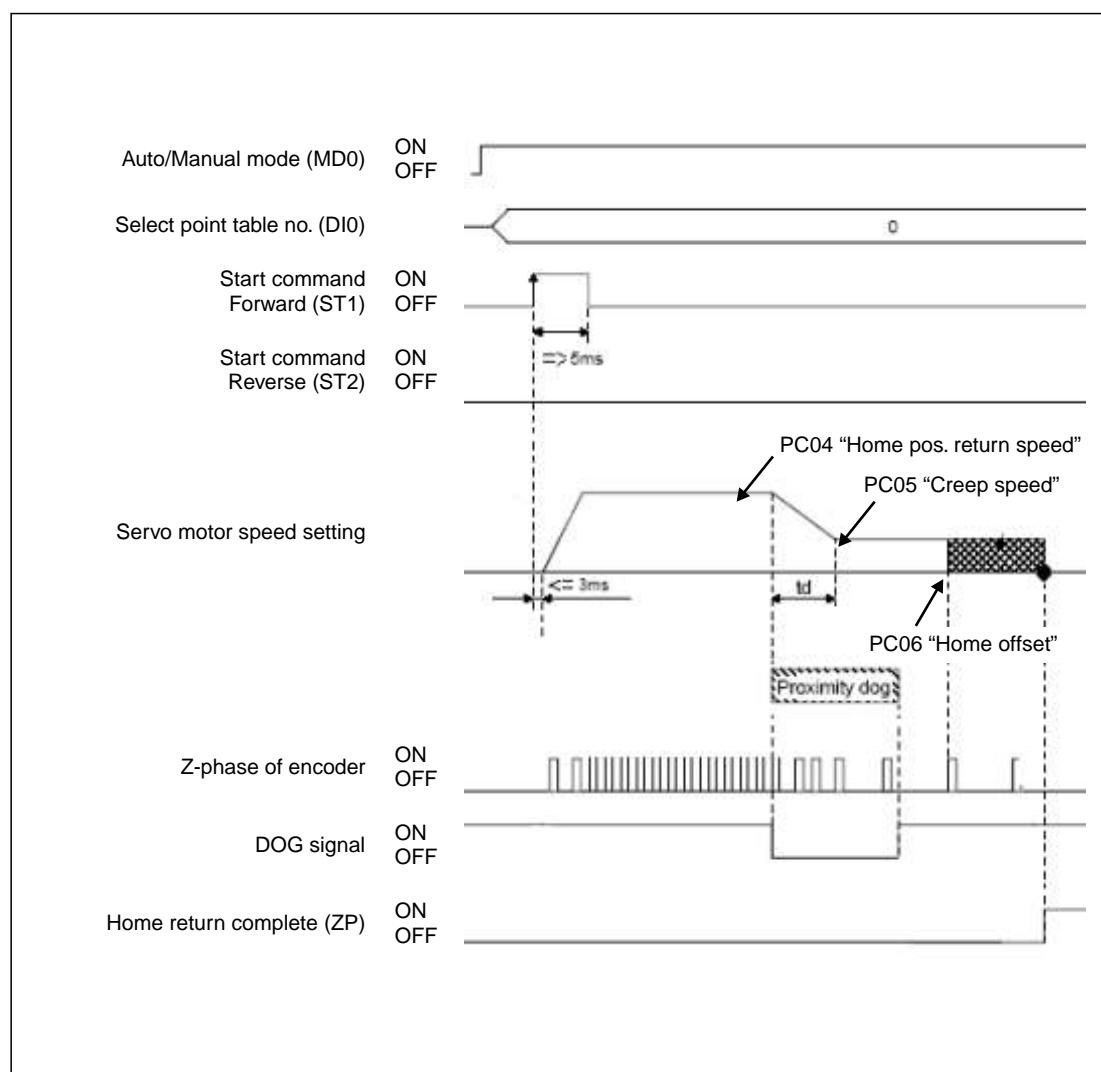Timing chart:**Fig. 4-10:** Home position return in proximity dog mode

| No. | Code | Function | Description | | | | | | | | | | |
|-------------------|---------------------------|-------------------------------------|---|-----------------|---------------------------|---|---|---|----|---|-----|---|------|
| PA05 ^① | *FTY | Feed length multiplication factor | Needed here to scale the home position value to the physical coordinate system when a home position offset (shift) has been set. <table border="1" style="margin-left: 20px;"> <tr> <td>Parameter value</td><td>Multiplication factor STM</td></tr> <tr> <td>0</td><td>1</td></tr> <tr> <td>1</td><td>10</td></tr> <tr> <td>2</td><td>100</td></tr> <tr> <td>3</td><td>1000</td></tr> </table> | Parameter value | Multiplication factor STM | 0 | 1 | 1 | 10 | 2 | 100 | 3 | 1000 |
| Parameter value | Multiplication factor STM | | | | | | | | | | | | |
| 0 | 1 | | | | | | | | | | | | |
| 1 | 10 | | | | | | | | | | | | |
| 2 | 100 | | | | | | | | | | | | |
| 3 | 1000 | | | | | | | | | | | | |
| PC02 ^① | *ZTY | Home position return mode | Selects the home position return mode: 0: Proximity dog mode (DOG) | | | | | | | | | | |
| PC03 ^① | *ZDIR | Home position return direction | 0: Incrementing counting of encoder pulses 1: Decrementing counting of encoder pulses | | | | | | | | | | |
| PC04 | ZRF | Home position return speed | Sets home position return speed until first detection of the Z-phase in [rpm]. | | | | | | | | | | |
| PC05 | CRF | Creep speed | Speed for precise movement to home position in [rpm] | | | | | | | | | | |
| PC06 | ZST | Home position offset (shift) | Distance between the encoder home position (Z-phase) and the physical home position in [μm]. Does not change the zero point of the physical coordinate system. | | | | | | | | | | |
| PC07 ^① | *ZPS | Home position return position value | The home position return stops when the Z-phase position is reached. You can enter a non-zero coordinate for this position [in $10^{\text{STM}} \mu\text{m}$] with this parameter. | | | | | | | | | | |
| PD16 ^① | *DIAB | Input signal polarity | Logical value for detection of the proximity dog signal (DOG): 0: Active DOG on logical "0" 1: Active DOG on logical "1" | | | | | | | | | | |

Table 4-2: Parameter reference table

^① You must turn the power off and on again to activate this parameter.

Example:

In the following example the physical home position is at the position of the Z-phase of the encoder. However, we now want to assign a non-zero value in the physical coordinate system to this position.

Parameter settings:

| Basic setting | | Basic setting (list) | | Gain/Filter | | Extension setting | | I/O setting | | Parameter block | |
|---------------|-------|--|--|-------------|--|-------------------|--------------------|-------------|--|-----------------|--|
| No. | Abbr. | Name | | | | Value | Units | | | Setting range | |
| PC01 | *OMD | For manufacturer setting | | | | 0000 | | | | 0000-0002h | |
| PC02 | *ZTY | Home position return type | | | | 0000 | | | | 0000-0004h | |
| PC03 | *ZDIR | Home position return direction | | | | 0000 | | | | 0000-0001h | |
| PC04 | ZRF | Home position return speed | | | | 200 | r/min | | | 0-50000 | |
| PC05 | CRF | Creep speed | | | | 20 | r/min | | | 0-50000 | |
| PC06 | ZST | Home position shift distance | | | | 0 | μm | | | 0-65535 | |
| PC07 | *ZPS | Home position return position data | | | | 1000 | 10 ³ μm | | | -32768-32767 | |
| PC08 | DCT | Moving distance after proximity dog | | | | 0 | 10 ³ μm | | | 0-65535 | |
| PC09 | ZTM | Stopper type home position return stopper time | | | | 100 | ms | | | 5-1000 | |
| PC10 | ZTT | Stopper type home position return torque limit value | | | | 15,0 | % | | | 1,0-100,0 | |
| PC11 | CRP | Rough match output range | | | | 0 | 10 ³ μm | | | 0-65535 | |
| PC12 | JOG | Jog speed | | | | 100 | r/min | | | 0-50000 | |
| PC13 | *STC | S-pattern acceleration/deceleration time constant | | | | | | | | 0-1000 | |
| PC14 | *BKC | Backlash compensation | | | | | | | | 0-32000 | |
| PC15 | ORP | For manufacturer setting | | | | | | | | 0000-0001h | |
| PC16 | MBR | Electromagnetic brake sequence output | | | | | | | | 0-1000 | |
| PC17 | ZSP | Zero speed | | | | | | | | 0-10000 | |
| PC18 | *BPS | Alarm history clear | | | | | | | | 0000-0001h | |
| PC19 | *ENRS | Encoder output pulse selection | | | | | | | | 0000-0021h | |
| PC20 | POIO | Output output settings | | | | | | | | 0-04 | |

Fig. 4-11: Relevant parameter settings for the example. The home position value is entered with PC07.

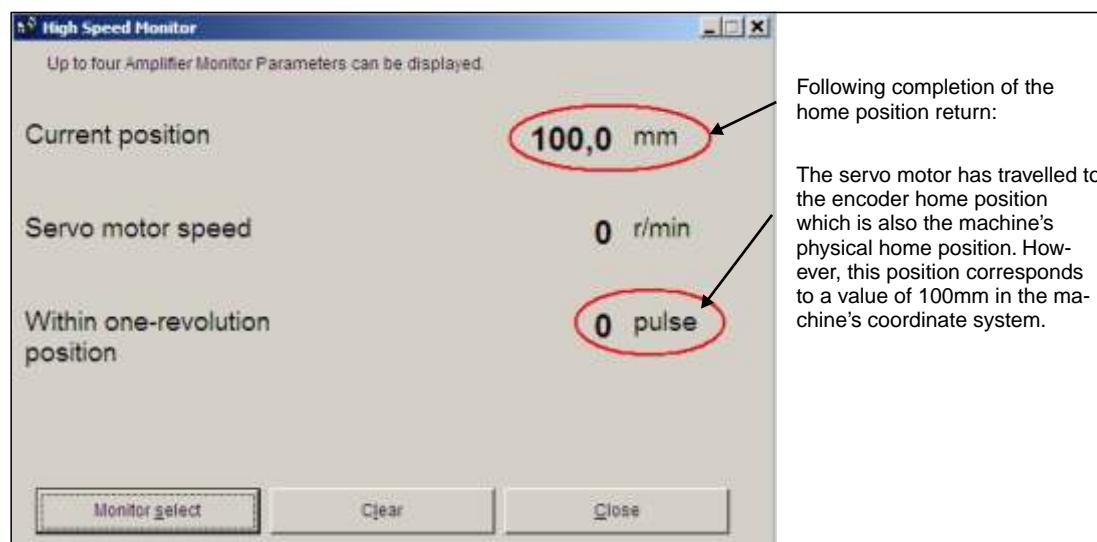


Fig. 4-12: Values shown when the home position return has been completed correctly

The position value is calculated as follows:

$$X = PA05 \cdot PC07 \text{ in [mm]}$$

In the above example with $PA05 = 1$ and $PC07 = 1000$ [$10^3 \mu\text{m}$] this gives us:

$$X = 1000 \cdot 10^1 \mu\text{m}$$

4.4 Configuration for Positioning

If you install the MR-J3-D01 I/O expansion you can use point table positioning, which allows you to select positions from a list of up to 256 table entries with a combination of eight digital inputs. Table 4-3 shows how binary input signals are encoded to address the point table entries.

| Digital Input Signals | | | | | | | | Selected Point Table Entry |
|-----------------------|-----|-----|-----|-----|-----|-----|-----|----------------------------|
| DI7 | DI6 | DI5 | DI4 | DI3 | DI2 | DI1 | DI0 | |
| 0 | 0 | 0 | 0 | 0 | 0 | 0 | 1 | 1 |
| 0 | 0 | 0 | 0 | 0 | 0 | 1 | 0 | 2 |
| 0 | 0 | 0 | 0 | 0 | 0 | 1 | 1 | 3 |
| 0 | 0 | 0 | 0 | 0 | 1 | 0 | 0 | 4 |
| . | . | . | . | . | . | . | . | . |
| . | . | . | . | . | . | . | . | . |
| . | . | . | . | . | . | . | . | . |
| 1 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 254 |
| 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 255 |

Table 4-3: Selection of point table entries with digital input signals

In the factory default configuration the incremental system is activated, which means that the absolute position detection system is turned off (**PA03** “absolute position detection system”). In this mode the current position is not stored when the power is turned off and you must thus perform a home position return every time the amplifier is powered on. The default configuration also uses absolute target positions (**PA01** “positioning control mode”).

| No. | Code | Function | Description | | | | | | | | | | | | | | | |
|-------------------|---------------------------|-------------------------------------|---|-----------------|---------------------------|-------------------------------------|---|---|-----------------------|---|----|-----------------------|---|-----|-----------------------|---|------|---------------------|
| PA01 ^① | *STY | Positioning control mode | 0: Absolute target position values 1: Incremental target position values | | | | | | | | | | | | | | | |
| PA03 ^① | *ABS | Absolute position detection system | 0: Incremental system (absolute detection off) 1: Absolute position detection system on | | | | | | | | | | | | | | | |
| PA05 ^① | *FTY | Feed length multiplication factor | Needed here to scale the home position value to the physical coordinate system when a home position offset (shift) has been set. <table border="1"> <thead> <tr> <th>Parameter value</th> <th>Multiplication factor STM</th> <th>Range of the target position values</th> </tr> </thead> <tbody> <tr><td>0</td><td>1</td><td>-999.999 ... +999.999</td></tr> <tr><td>1</td><td>10</td><td>-9999.99 ... +9999.99</td></tr> <tr><td>2</td><td>100</td><td>-99999.9 ... +99999.9</td></tr> <tr><td>3</td><td>1000</td><td>-999999 ... +999999</td></tr> </tbody> </table> | Parameter value | Multiplication factor STM | Range of the target position values | 0 | 1 | -999.999 ... +999.999 | 1 | 10 | -9999.99 ... +9999.99 | 2 | 100 | -99999.9 ... +99999.9 | 3 | 1000 | -999999 ... +999999 |
| Parameter value | Multiplication factor STM | Range of the target position values | | | | | | | | | | | | | | | | |
| 0 | 1 | -999.999 ... +999.999 | | | | | | | | | | | | | | | | |
| 1 | 10 | -9999.99 ... +9999.99 | | | | | | | | | | | | | | | | |
| 2 | 100 | -99999.9 ... +99999.9 | | | | | | | | | | | | | | | | |
| 3 | 1000 | -999999 ... +999999 | | | | | | | | | | | | | | | | |

Table 4-4: Parameter reference

^① To activate this parameter you must switch the amplifier power off and on again.

The following example shows some typical configuration settings used for many common positioning applications:

Procedure:

- ① Select the incremental system for positions with **PA03 *ABS**.
- ② Select absolute value command mode for target positions with **PA01 *STY**.
- ③ Set a multiplication factor with **PA05 *FTY = 1 => 10 times factor**.

This gives us the following position system:

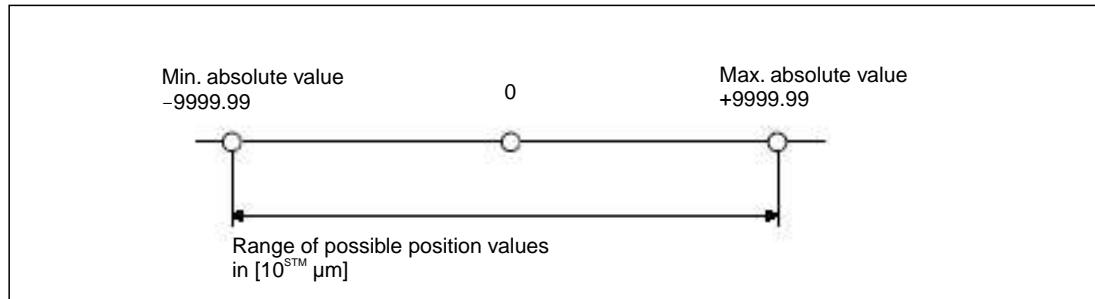


Fig. 4-13: Effective range of the position values with the sample settings

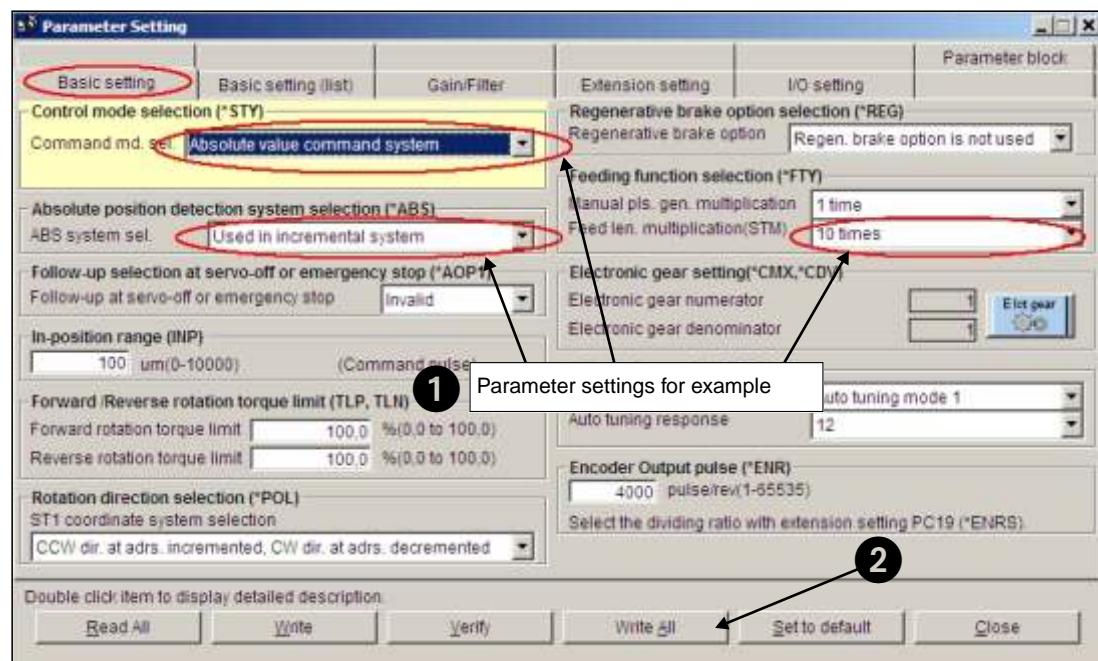


Fig. 4-14: Relevant parameters affecting the target position setpoint values

NOTE

If target positions are entered using the incremental system it is not possible to change the rotation direction via the point table. In this mode the rotation direction can only be changed with the start commands (ST1/ST2).

- ④ The point table entries for the individual positioning steps are configured in the columns numbered ① to ④ in the point table list shown below.

| No. | Position Data | Speed Data | Accel Time | Decel Time | Dwell Time | Aux. Func. | M Code |
|-----|---------------|------------|------------|------------|------------|------------|--------|
| 1 | 2000,00 | 100 | 100 | 100 | 0 | 0 | 0 |
| 2 | 3000,00 | 2000 | 100 | 100 | 0 | 0 | 0 |
| 3 | 5000,00 | 300 | 300 | 200 | 0 | 0 | 0 |
| 4 | 1500,00 | 1500 | 100 | 100 | 0 | 0 | 0 |
| 5 | 1500,00 | 500 | 80 | 100 | 0 | 0 | 0 |
| 6 | 500,00 | 250 | 100 | 100 | 0 | 0 | 0 |
| 7 | 2000,00 | 1235 | 50 | 50 | 0 | 0 | 0 |
| 8 | 1000,00 | 300 | 100 | 100 | 0 | 0 | 0 |
| 9 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 10 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 11 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 12 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 13 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |


STM 10 Times Set STM to the same value as that of parameter PA05

Insert Delete Read All Write Verify Write All Close

Fig. 4-15: Example of a positioning application with 8 positioning steps

Tips for editing point table entries:

- The value in the *Aux. Func.* column should normally always be zero. Otherwise the system will automatically jump to the next entry in the table and execute the next positioning command after completing a positioning step, even if there is no change in the input signals.
- The *Dwell Time* column can be used to insert a delay between reaching the target position of the positioning step for the current table line and continuing to the next table line. This option should only be used when multiple positioning steps are performed automatically, without changes in the input signals.
- The button *Insert* inserts a new line above the selected table line. *Delete* deletes the selected line.
- The *Verify* function checks whether the positioning table in MR Configurator matches the table stored in the connected servo amplifier. If the tables don't match a message is displayed showing the line number where the difference was found:

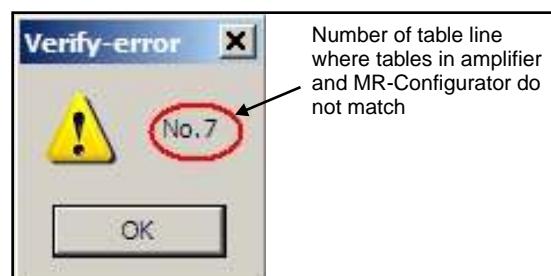

- Always deactivate start command ST1/ST2 before starting a new positioning sequence. Then you can select a new table entry with DI0 - DI7 and start the positioning sequence with ST1/ST2.
- Table entries are not reset when you restore the amplifier's factory default settings!
- You do not need to turn the amplifier off and on again after changing table entries.

NOTE

| Please see the instruction manual for full details on all these procedures.

4.4.1 Importing and exporting point tables

There are two different ways to store the point table from your project so that you can edit it again later in external programs and MR Configurator:

- Export the point table as a text file with the extension **.ptb**. This creates a plain text file that can be edited with a normal text editor.
- Export the point table as a file with the extension **.csv**. These files contain data that can be edited by spreadsheet programs like Microsoft Excel.

Procedure:

- ① The Point Table List window must be open and active.
- ② How to export the point table to a file:

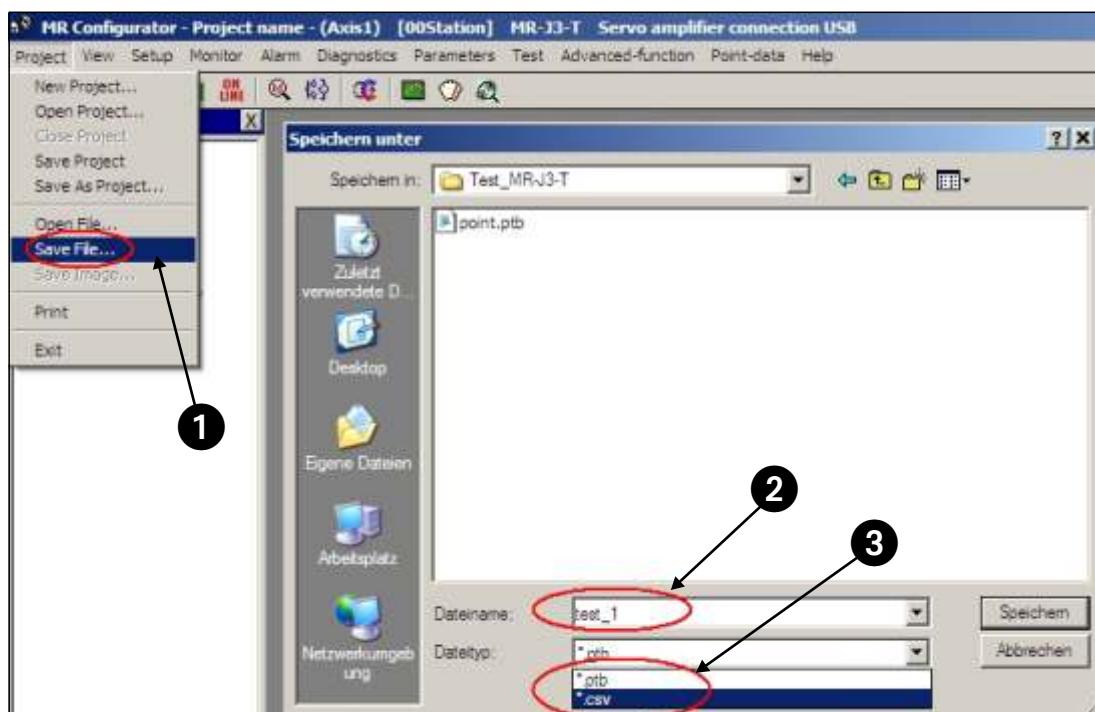


Fig. 4-16: Exporting the point table to a file for archival or editing

③ How to open/import a point table data file:

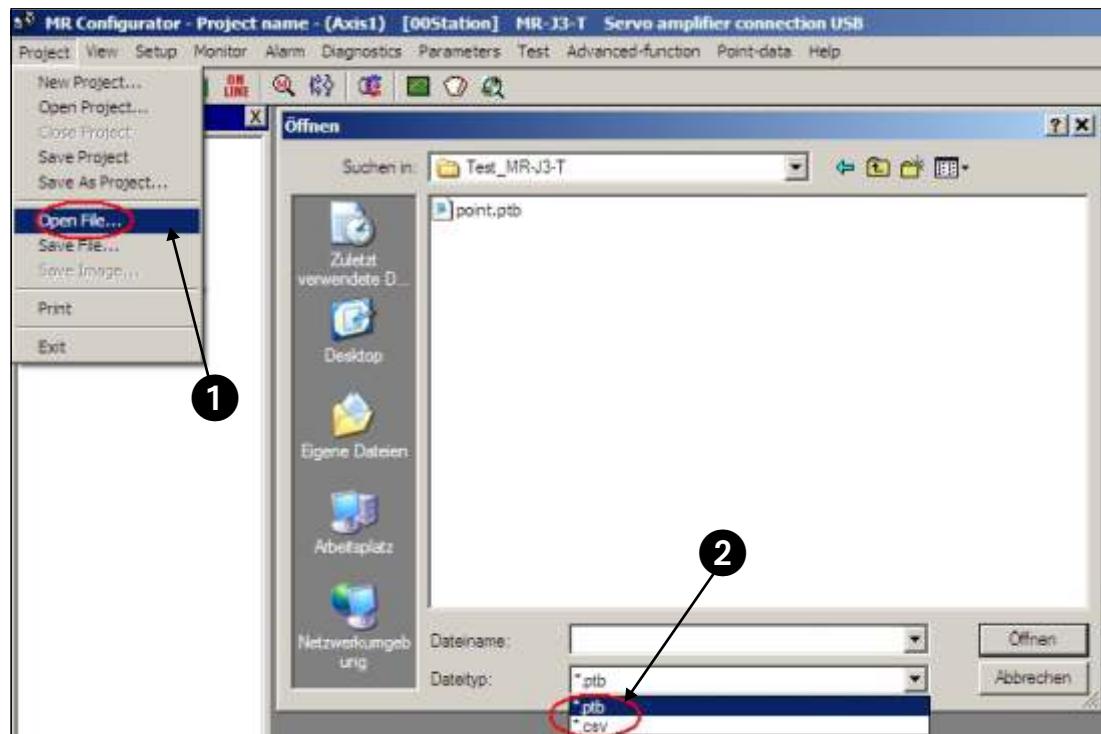


Fig. 4-17: Opening a point table file to import the data

| No. | Position Data | Speed Data | Accel Time | Decel Time | Dwell Time | Aux. Func. | M Code |
|-----|---------------|------------|------------|------------|------------|------------|--------|
| 1 | 2000,00 | 100 | 100 | 100 | 0 | 0 | 0 |
| 2 | 3000,00 | 2000 | 100 | 100 | 0 | 0 | 0 |
| 3 | 5000,00 | 300 | 300 | 200 | 0 | 0 | 0 |
| 4 | 1500,00 | 1500 | 100 | 100 | 0 | 0 | 0 |
| 5 | 1500,00 | 500 | 80 | 100 | 0 | 0 | 0 |
| 6 | 500,00 | 250 | 100 | 100 | 0 | 0 | 0 |
| 7 | 2000,00 | 1235 | 50 | 50 | 0 | 0 | 0 |
| 8 | 1000,00 | 300 | 100 | 100 | 0 | 0 | 0 |
| 9 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 10 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 11 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 12 | 0,00 | 0 | 0 | 0 | 0 | 0 | 0 |
| 13 | n.nn | n | n | n | n | n | n |

Fig. 4-18: Point table position data imported from a .csv file

4.5 Functional Test of Digital Input Positioning

Normally you need a simple controller to set the digital inputs used to select the point table position entries, for example a PC, a mini PLC or an HMI control terminal. This chapter explains how you can perform a thorough check of the functionality of the positioning control functions without needing to perform the additional work of programming and installing a controller.

Fig. 4-19 shows a test installation without an external controller. Note that the FX Simulation Box used in this setup can set a maximum of 14 digital inputs.

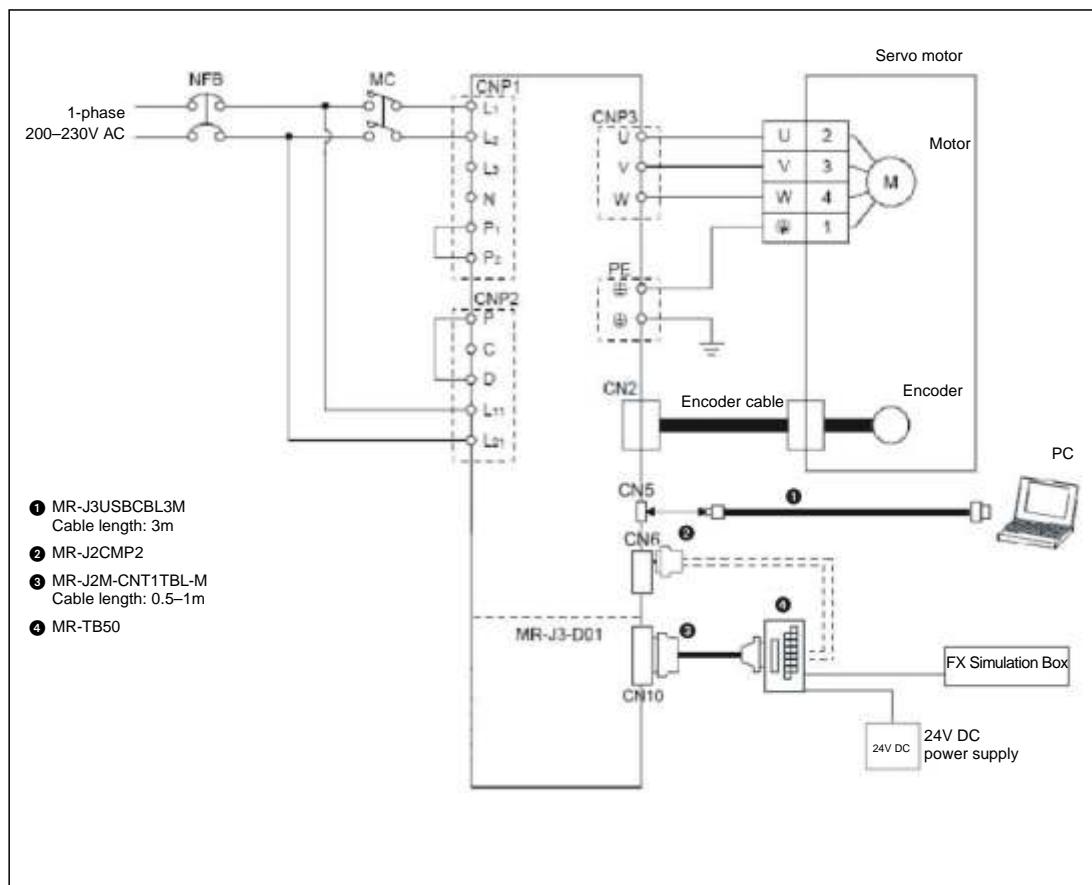


Fig. 4-19: Test setup for simulating positioning with digital inputs

NOTE

The test setup shown above does not use any safety features for the tests (EMG, OFF). You should thus only use this setup in a controlled test environment where errors cannot cause any danger for personnel or equipment!

MR Configurator can monitor all the inputs and outputs of the MR-J3-T, including those on the MR-J3-D01 I/O extension.

Procedure:

- ① Connect the PC/notebook to the USB port (CN5) of the servo amplifier using cable MR-J3USBCBL3M.
- ② Start MR Configurator and make the following selections:
 - Select the MR-J3-T series amplifier.
 - Select the MR-J3-D01 expansion card (“option unit”).

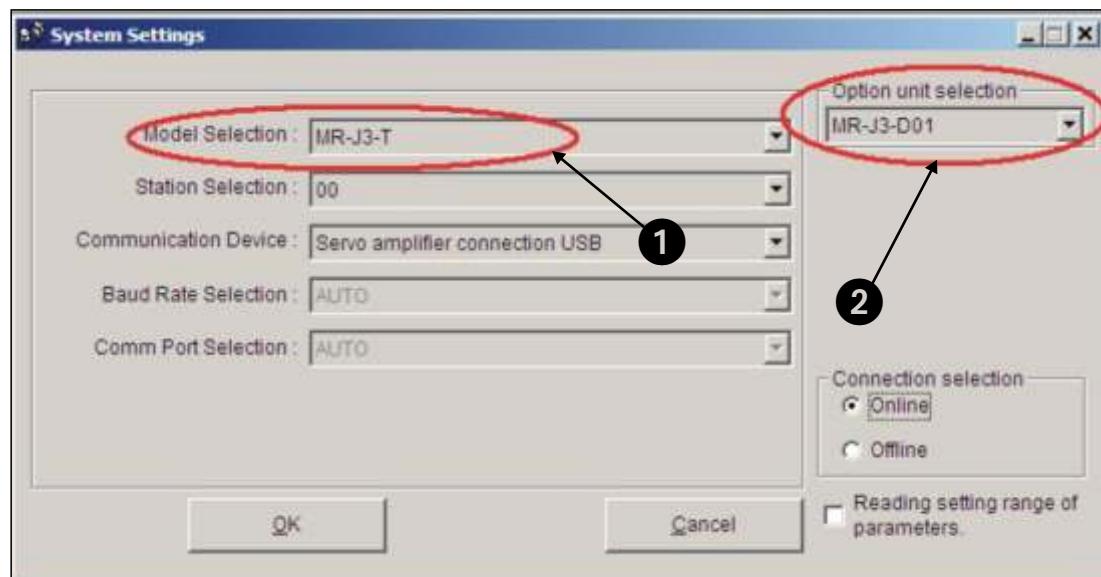


Fig. 4-20: Settings in MR Configurator for checking the MR-J3-T with the MR-J3-D01 expansion card

After this you can monitor the signals of the expansion card with the option *Option unit I/F display* in the *Monitor* menu.

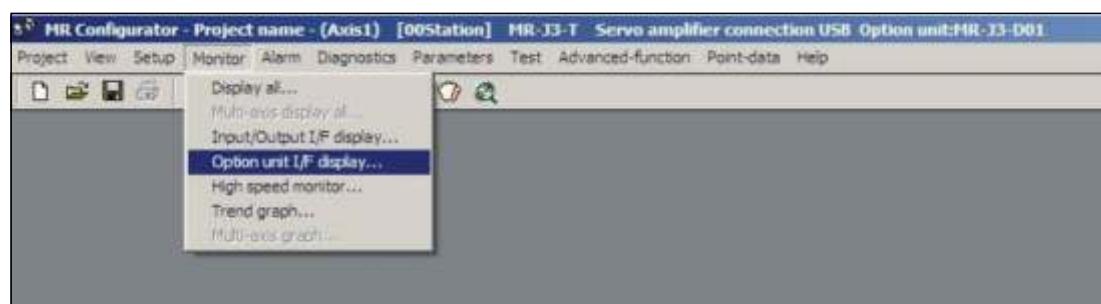


Fig. 4-21: Selection of the “Option unit I/F display” terminal monitor option

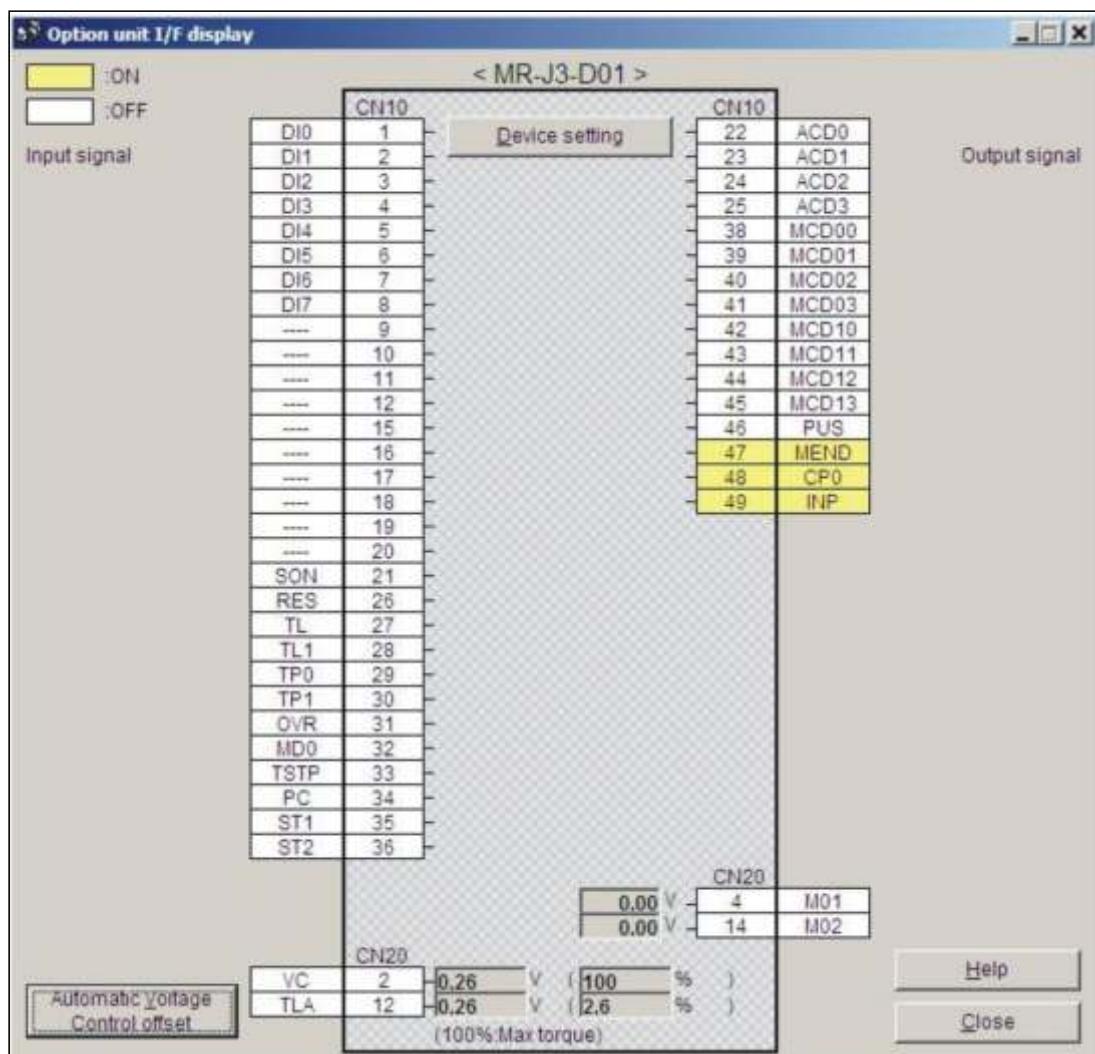


Fig. 4-22: The "Option unit I/F display" terminal monitoring window

5 Positioning via a CC-Link Network

As an alternative to using digital signals you can also control positioning with MR-J3-T servo amplifiers via a CC-Link network connection.

NOTE

Before proceeding ensure that the MR-J3-D01I/O expansion card is not installed. If it is installed CC-Link communications will be disabled.

5.1 Additional Connections

In addition to the minimum configuration described in chapter 3.1 you also need to connect the CC-Link cable and the cabling for connector CN6 for this mode.


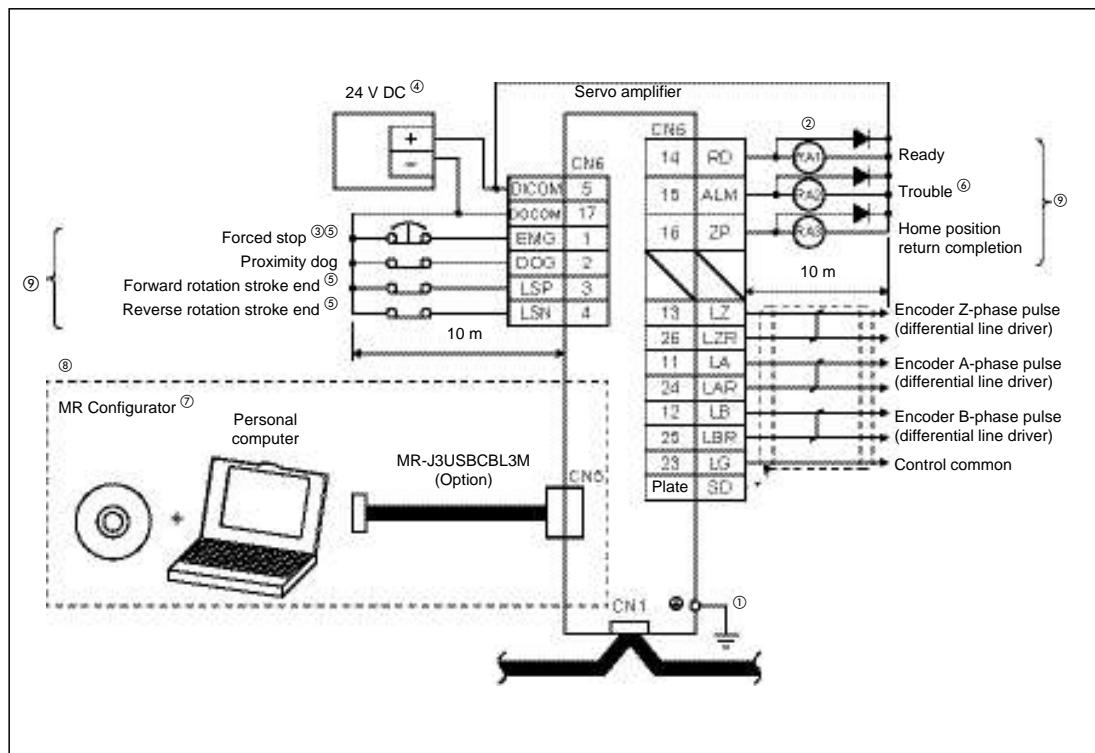


Fig. 5-1: Connections for operating the servo amplifier via a CC-Link network

- ① To prevent an electric shock, always connect the protective earth (PE) terminal (terminal marked \ominus) of the servo amplifier to the protective earth (PE) of the control box.
- ② Connect the diode in the correct direction. If it is connected reversely, the servo amplifier will be faulty and will not output signals, disabling the emergency stop (EMG) and other protective circuits.
- ③ The forced stop switch (normally closed contact) must be installed.

- ④ Supply 24 V DC $\pm 10\%$ 150 mA current for interfaces from the outside. 150 mA is the value applicable when all I/O signals are used. The current capacity can be decreased by reducing the number of I/O points.
- ⑤ When starting operation, always turn on forced stop (EMG) and Forward/Reverse rotation stroke end (LSP/LSN). (Normally closed contacts)
- ⑥ Trouble (ALM) turns on in normal alarm-free condition.
- ⑦ Use MRZJW3-SETUP 211E.
- ⑧ Personal computers or parameter modules can also be connected via the CN3 connector, enabling RS422 communication. Note that using the USB communication function (CN5 connector) prevents the RS422 communication function (CN3 connector) from being used, and vice versa. They cannot be used together.

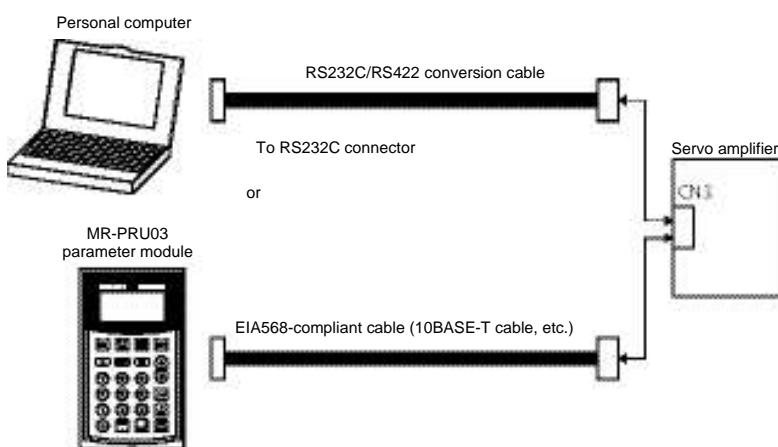

- ⑨ For the sink I/O interface.

Connections for the CC-Link network

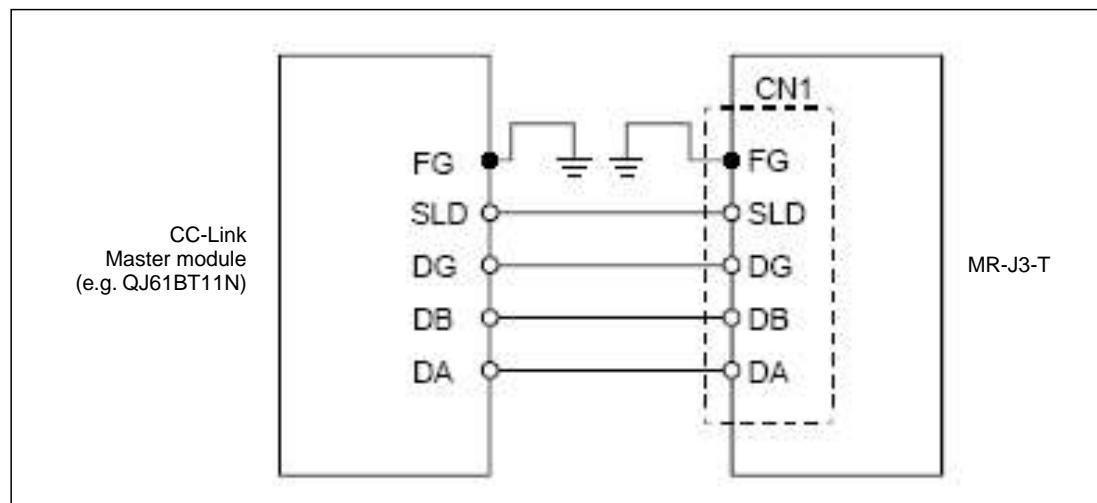


Fig. 5-2: Connections between the servo amplifier and the CC-Link master module

NOTE

You must install a terminating resistor on terminals DB and DB on the physical first and last stations in the CC-Link network. The required ohmage of the resistor depends on the cable length, please check the version V1.10 specifications for details.

5.2 CC-Link Communication Settings

5.2.1 Settings on the servo amplifier

In the instructions below we are assuming that you have an operating CC-Link network with the following specifications:

- Data rate 156Kbit/s
- The master station is a QJ61BT11N module that is integrated in a System Q controller platform with a Q02H-CPU.

Procedure:

- ① Set the number of reserved stations:

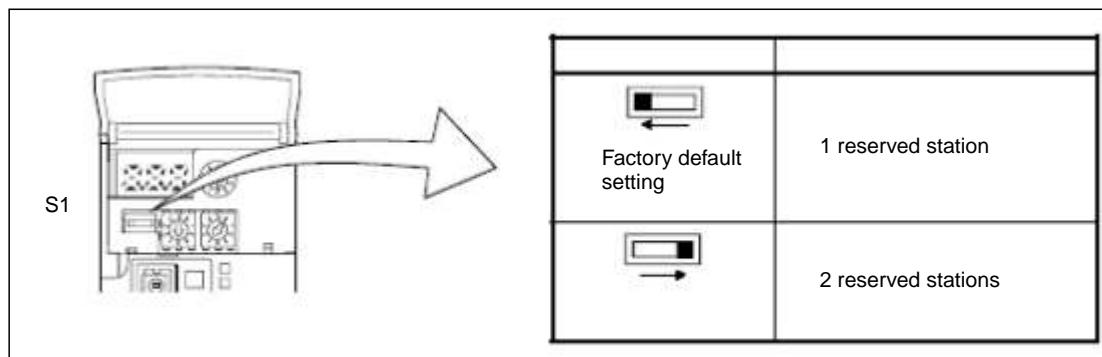


Fig. 5-3: Correct position of switch S1 for setting the number of reserved stations

- ② Set the station address (max. value 64):

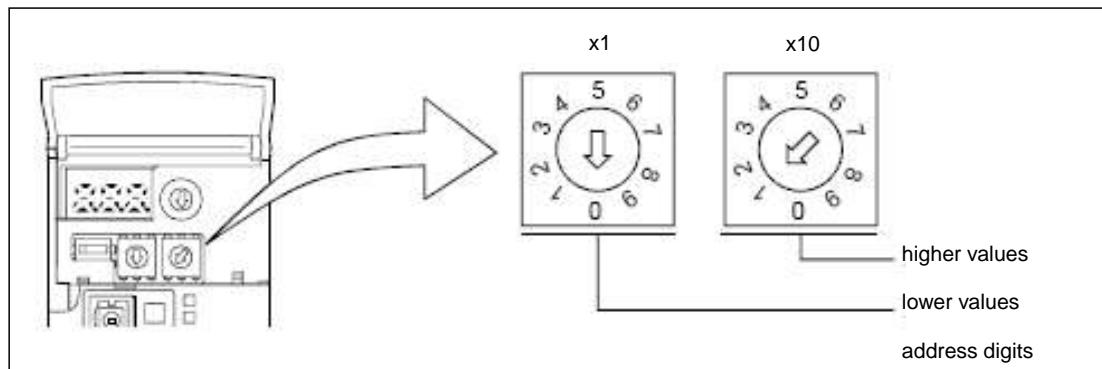


Fig. 5-4: Set switches x1 and x10 to the correct station address

③ Set the data rate:

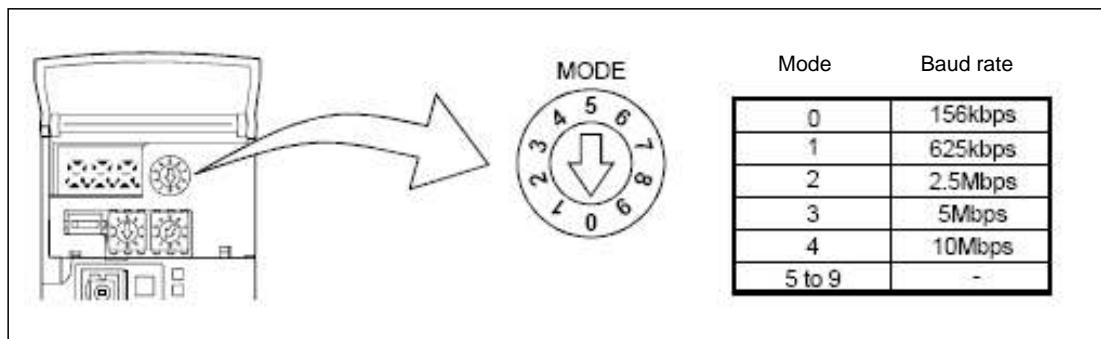


Fig. 5-5: Mode switch setting for the network data rate

NOTE

The servo amplifier settings required for point table positioning are described in chapters 4.2 through 4.4. Please check that these settings have been made correctly before proceeding.

5.2.2 Configuration for communication with GX IEC Developer

Generally, positioning control is performed via a CC-Link network in applications where an additional PLC system is used for automation tasks as well as the integrated controller in the amplifier. In this example we will thus only provide detailed descriptions of the settings required to integrate the servo amplifier in your project.

Procedure:

How to open an existing project in GX IEC Developer:

- ① Select *Network* ① in the project directory tree in the left window.
- ② Select *CC-Link* ② in the *Network Parameter* box.
- ③ This opens the window *Network parameters: Setting the CC-Link list* where you can now enter the settings shown in Fig. 5-6 ③.

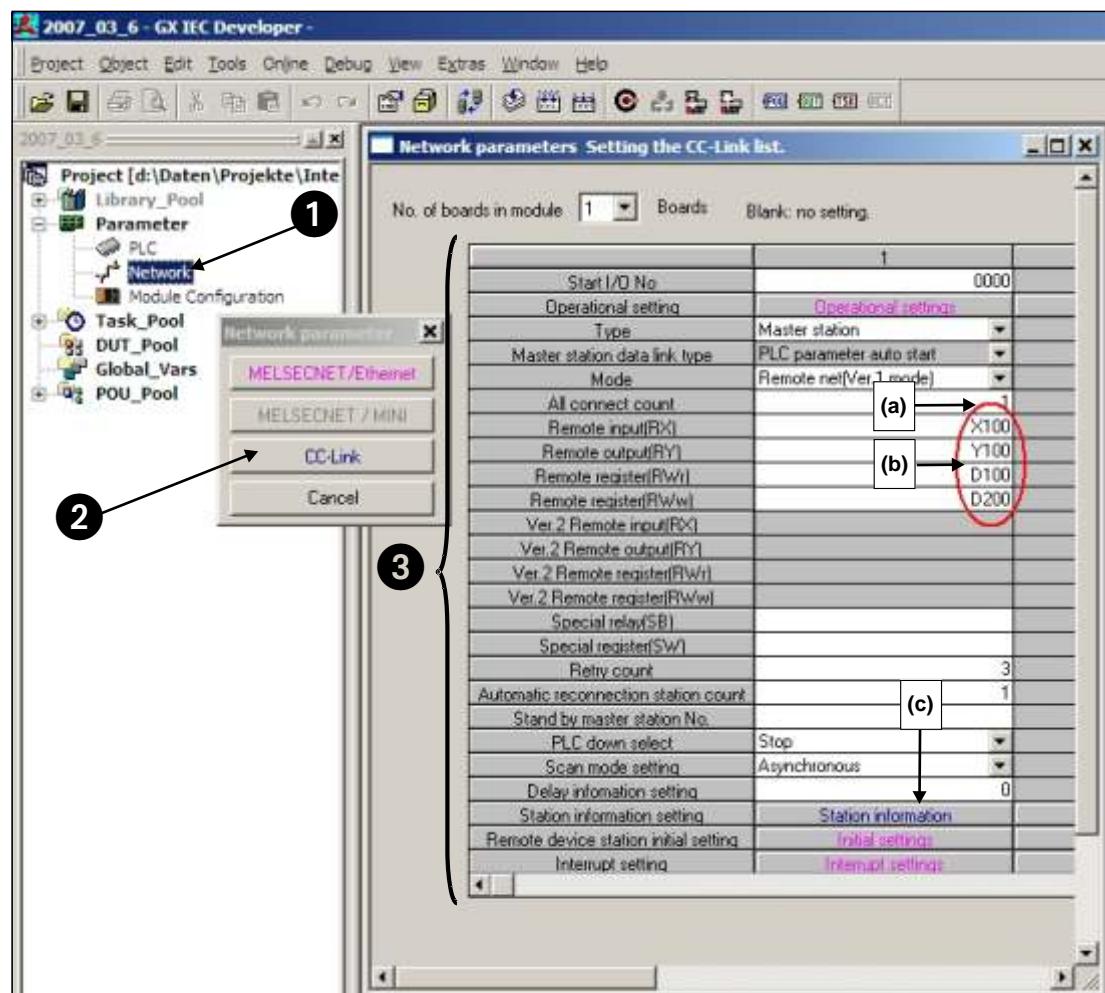



Fig. 5-6: Settings required in GX IEC Developer for CC-Link communication between the controller and the servo amplifier

Notes on the network settings:

- (a) In the example only one servo amplifier is connected to the CC-Link network. This value must be increased by the number of slave stations installed if applicable.
- (b) These values specify which bits or data words are to be used to control the servo amplifier. The settings shown in the example are for the following assignments:

| PLC -> Servo Amplifier | | | Servo Amplifier -> PLC | | |
|------------------------|-----------|---------|------------------------|-----------|---------|
| PLC I/Os | Registers | Signals | PLC I/Os | Registers | Signals |
| Y100 | RYn0 | SON | X100 | RXn0 | RD |
| Y101 | RYn1 | ST1 | X101 | RXn1 | INP |
| Y102 | RYn2 | ST2 | X103 | RXn3 | ZP |
| Y103 | RYn3 | DOG | X11A | RX(n+1)A | ALM |
| Y104 | RYn4 | LSP | | | |
| Y105 | RYn5 | LSN | | | |
| Y106 | RYn6 | MD0 | | | |
| Y10A | RYnA | DI0 | | | |
| Y10B | RYnB | DI1 | | | |
| Y10C | RYnC | DI2 | | | |
| Y10D | RYnD | DI3 | | | |
| Y10E | RYnE | DI4 | | | |
| Y10F | RYnF | RES | | | |

NOTE:
Signals DI5, DI6 and DI7 are only available when the amplifier is configured to occupy 2 stations in the network.

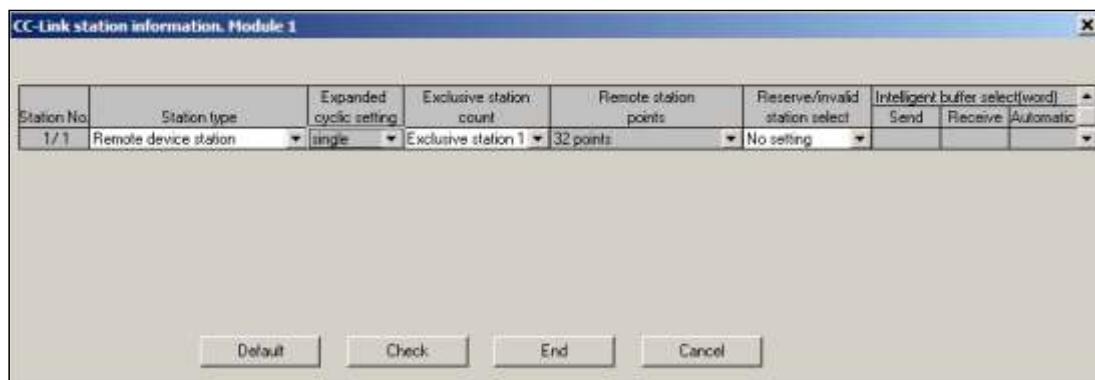Table 5-1: Signal assignments**(c) Slave station type setting:****Fig. 5-7: This configuration also enables exchange of data words**

- ④ Connect the PC to the PLC and transfer the modified project to the controller.

NOTE

If the CC-Link connection to the servo amplifier is established successfully the **L.RUN**, **SD** und **RD** status LEDs on the servo amplifier will light up.

5.3 Testing the Servo Amplifier via CC-Link

Before proceeding it is a good idea use the monitoring function in GX IEX Developer to check that the individual servo functions can be started correctly (e.g. return to home, positioning). After this you can then test the correct operation of the servo system with the PLC program.

Procedure:

- ① Activate monitoring mode.
- ② Select *Entry Data Monitor* in the *Online* menu.
- ③ Enter the individual remote I/Os to be set or monitored.

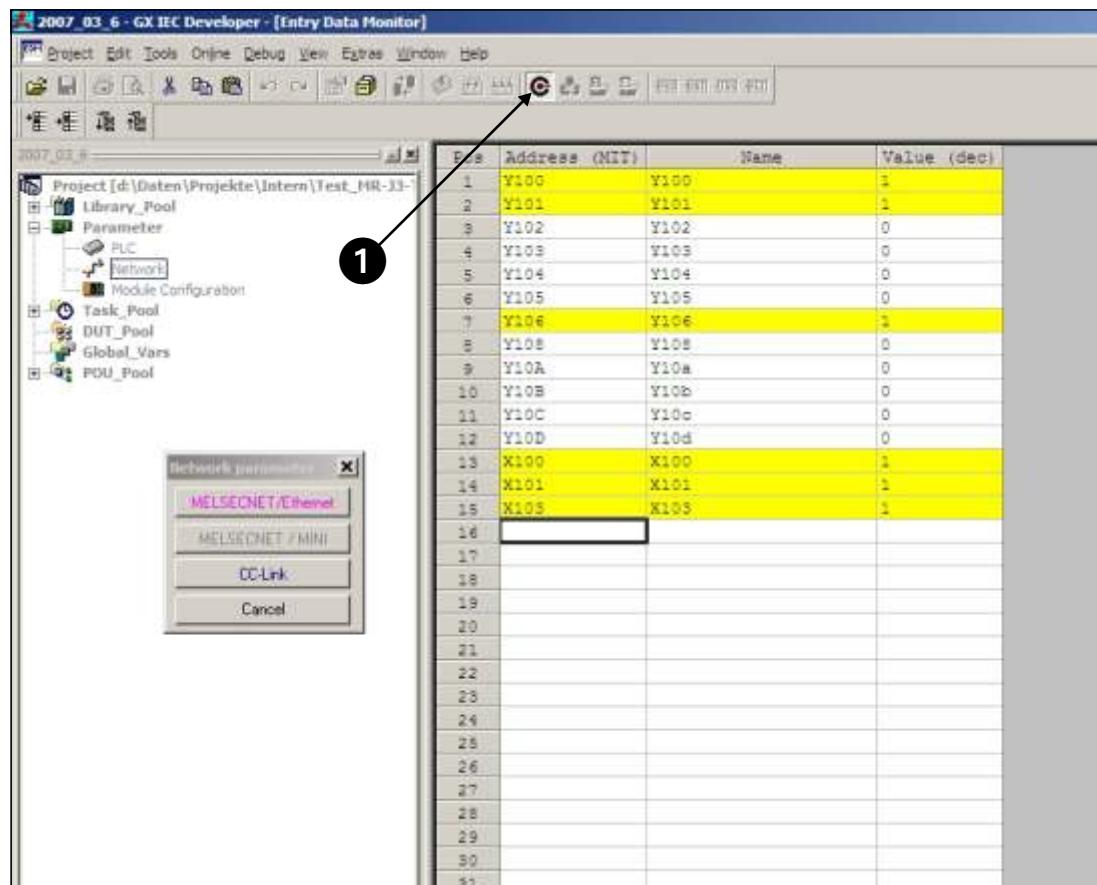


Fig. 5-8: The Entry Data Monitor window where you can set remote I/Os to test the servo functions

A Appendix

A.1 Digital Signals – Quick Reference

| Connector Pins | Signal Codes | | Description | DI / DO | |
|----------------|-------------------------|----------|--|---------|--|
| | DI/DO | CC-Link | | | |
| CN6-1 | EMG | – | Forced stop - emergency safety signal: The signal is permanently assigned to this pin and must be activated for motor control. | DI | |
| CN6-2 | DOG | RYn3 | Proximity dog switch: This signal is used for some of the home position return modes. (See chapter 4.3) | DI | |
| CN6-3 | LSP | RYn4 | Forward rotation stroke end switch | DI | |
| CN6-4 | LSN | RYn5 | Reverse rotation stroke end switch | DI | |
| CN6-14 | RD | RXn0 | Servo amplifier ready | DO | |
| CN6-15 | ALM | RX(n+1)A | Alarm, signals a servo error | DO | |
| CN6-16 | ZP | RXn3 | Home position return completed successfully | DO | |
| | | | | | |
| CN10-1 | DI0 | RYnA | Select point table entry, i.e. activate a line in the table for positioning. Combinations of signals DI0 through DI7 (see Table 4-3) can be used to select up to 256 positioning steps. NOTE: Signals DI5, DI6 and DI7 are only available when the amplifier occupies 2 stations in the network, thus making 64 bits available via CC-Link. | DI | |
| | Point table entry no. 1 | | | DI | |
| CN10-2 | DI1 | RYnB | | DI | |
| | Point table entry no. 2 | | | DI | |
| CN10-3 | DI2 | RYnC | | DI | |
| | Point table entry no. 3 | | | DI | |
| CN10-4 | DI3 | RYnD | | DI | |
| | Point table entry no. 4 | | | DI | |
| CN10-5 | DI4 | RYnE | | DI | |
| | Point table entry no. 5 | | | DI | |
| CN10-6 | DI5 | RY(n+2)3 | | DI | |
| | Point table entry no. 6 | | | DI | |
| CN10-7 | DI6 | RY(n+2)4 | | DI | |
| | Point table entry no. 7 | | | DI | |
| CN10-8 | DI7 | RY(n+2)5 | | DI | |
| | Point table entry no. 8 | | | DI | |
| CN10-13 | DICOM | – | Connection for an external power supply for the digital control terminals. Negative connection for source interface logic (PNP). | DI | |
| CN10-14 | | | | | |
| CN10-21 | SON | RYn0 | SERVO ON: Activating the SON signal powers on the base circuit and makes the amplifier ready for operation. | DI | |
| CN10-22 | ACD0 | – | Digital output signals for encoded error messages (see Appendix A.3) | DO | |
| CN10-23 | ACD1 | – | | | |
| CN10-24 | ACD2 | – | | | |
| CN10-25 | ACD3 | – | | | |
| CN10-26 | RES | RY1A | Reset for error messages | DI | |
| CN10-32 | MD0 | RYn6 | Switch between automatic/manual mode: The MD0 signal must be off for operation in jog mode. The signal must be activated before starting a home position return or positioning. | DI | |
| CN10-35 | ST1 | RYn1 | Start signal for forward rotation | DI | |
| CN10-36 | ST2 | RYn2 | Start signal for reverse rotation | DI | |
| CN10-37 | DOCO | – | Connection for an external power supply for the digital control terminals. Positive connection for source interface logic (PNP). | DI | |
| CN10-49 | INP | RXn1 | IN Position: Target position reached signal. | DO | |

Table A-1: Digital signals - quick reference

A.2 Standard Parameters – Quick Reference

| No. | Code | Function | Description | | | | | | | | | | | | | | | |
|-------------------|---------------------------|---------------------------------------|--|-----------------|---------------------------|-------------------------------------|---|---|-----------------------|---|----|-----------------------|---|-----|-----------------------|---|------|---------------------|
| PA01 ^① | *STY | Positioning control mode | 0: Absolute value command system for target positions 1: Incremental value command system for target positions | | | | | | | | | | | | | | | |
| PA03 ^① | *ABS | Absolute position detection system | 0: Incremental system (absolute position detection off) 1: Absolute position detection system on | | | | | | | | | | | | | | | |
| PA05 ^① | *FTY | Feed length multiplication factor | Needed here to scale the home position value to the physical coordinate system when a home position offset (shift) has been set. <table border="1" style="margin-left: 20px;"> <thead> <tr> <th>Parameter value</th> <th>Multiplication factor STM</th> <th>Range of the target position values</th> </tr> </thead> <tbody> <tr> <td>0</td> <td>1</td> <td>-999.999 ... +999.999</td> </tr> <tr> <td>1</td> <td>10</td> <td>-9999.99 ... +9999.99</td> </tr> <tr> <td>2</td> <td>100</td> <td>-99999.9 ... +99999.9</td> </tr> <tr> <td>3</td> <td>1000</td> <td>-999999 ... +999999</td> </tr> </tbody> </table> | Parameter value | Multiplication factor STM | Range of the target position values | 0 | 1 | -999.999 ... +999.999 | 1 | 10 | -9999.99 ... +9999.99 | 2 | 100 | -99999.9 ... +99999.9 | 3 | 1000 | -999999 ... +999999 |
| Parameter value | Multiplication factor STM | Range of the target position values | | | | | | | | | | | | | | | | |
| 0 | 1 | -999.999 ... +999.999 | | | | | | | | | | | | | | | | |
| 1 | 10 | -9999.99 ... +9999.99 | | | | | | | | | | | | | | | | |
| 2 | 100 | -99999.9 ... +99999.9 | | | | | | | | | | | | | | | | |
| 3 | 1000 | -999999 ... +999999 | | | | | | | | | | | | | | | | |
| PA14 ^① | *POL | Servo motor rotation direction | Motor rotation direction (looking at shaft end facing motor): 0: Anticlockwise when ST1 signal is active 1: Clockwise when ST1 signal is active | | | | | | | | | | | | | | | |
| PC02 ^① | *ZTY | Home position return mode | Selects mode to be used for home position return: 0: Proximity dog mode | | | | | | | | | | | | | | | |
| PC03 ^① | *ZDIR | Home position return direction | 0: Incrementing counting of encoder pulses 1: Decrementing counting of encoder pulses | | | | | | | | | | | | | | | |
| PC04 | ZRF | Home position return speed | Sets home position return speed until first detection of the Z-phase in [rpm]. | | | | | | | | | | | | | | | |
| PC05 | CRF | Creep speed | Speed for precise movement to home position in [rpm] | | | | | | | | | | | | | | | |
| PC06 | ZST | Home position offset (shift) | Distance between the encoder home position (Z-phase) and the physical home position in [μm]. Does not change the zero point of the physical coordinate system. | | | | | | | | | | | | | | | |
| PC07 ^① | *ZPS | Home position return position value | The home position return stops when the Z-phase position is reached. You can enter a non-zero coordinate for this position [in $10^{\text{STM}} \mu\text{m}$] with this parameter. | | | | | | | | | | | | | | | |
| PD01 ^① | *DIA1 | Automatic activation of input signals | This parameter configures the amplifier to automatically set the digital signals internally to a logical "1" when the power is switched on. | | | | | | | | | | | | | | | |
| PD01 ^① | *DIAB | Polarity of the input signal | Logical value for detection of the proximity dog signal (DOG): 0: Active DOG on logical "0" 1: Active DOG on logical "1" | | | | | | | | | | | | | | | |

Table A-2: Standard parameters – quick reference

^① To activate this parameter you must switch the amplifier power off and on again.

A.3 Alarms and Warning Messages

| | Display | Alarm Code ^④ | | | | Error | Alarm Reset | | |
|--------|---------|-------------------------|-----------------|-----------------|-----------------|---|---------------------|----------------|--|
| | | ACD3 (Bit 3) | ACD2 (Bit 2) | ACD1 (Bit 1) | ACD0 (Bit 0) | | Power Supply OFF | ON | MR- Configurator/ HMI ^③ |
| Alarms | A10 | 0 | 0 | 1 | 0 | Undervoltage | ✓ | ✓ | ✓ |
| | A12 | 0 | 0 | 0 | 0 | Memory error 1 | ✓ | — | — |
| | A13 | 0 | 0 | 0 | 0 | Clock error | ✓ | — | — |
| | A15 | 0 | 0 | 0 | 0 | Memory error 2 (E ² PROM) | ✓ | — | — |
| | A16 | 0 | 1 | 1 | 0 | Encoder error 1 (at power on) | ✓ | — | — |
| | A17 | 0 | 0 | 0 | 0 | Board error | ✓ | — | — |
| | A19 | 0 | 0 | 0 | 0 | Memory error 2 (Flash ROM) | ✓ | — | — |
| | A1A | 0 | 1 | 1 | 0 | Incorrect servo motor | ✓ | — | — |
| | A20 | 0 | 1 | 1 | 0 | Encoder error 2 | ✓ | — | — |
| | A24 | 1 | 1 | 0 | 0 | Main circuit error | ✓ | ✓ | ✓ |
| | A25 | 1 | 1 | 1 | 0 | Absolute position lost/erased | ✓ | — | — |
| | A30 | 0 | 0 | 0 | 1 | Regenerative braking overload | ✓ ^① | ✓ ^① | ✓ ^① |
| | A31 | 0 | 1 | 0 | 1 | Overspeed | ✓ | ✓ | ✓ |
| | A32 | 0 | 1 | 0 | 0 | Overcurrent | ✓ | — | — |
| | A33 | 1 | 0 | 0 | 1 | Overvoltage | ✓ | ✓ | ✓ |
| | A35 | 1 | 1 | 0 | 1 | Input frequency too high | ✓ | — | — |
| | A37 | 1 | 0 | 0 | 0 | Parameter error | ✓ | — | — |
| | A45 | 0 | 0 | 1 | 1 | Main circuit overheat | ✓ ^① | ✓ ^① | ✓ ^① |
| | A46 | 0 | 0 | 1 | 1 | Servo motor overheat | ✓ ^① | ✓ ^① | ✓ ^① |
| | A47 | 0 | 0 | 1 | 1 | Cooling fan error | ✓ | — | — |
| | A50 | 0 | 0 | 1 | 1 | Overload 1 | ✓ ^① | ✓ ^① | ✓ ^① |
| | A51 | 0 | 0 | 1 | 1 | Overload 2 | ✓ ^① | ✓ ^① | ✓ ^① |

Table A-3: Error messages(1)

| | Display | Alarm Code ⁽⁴⁾ | | | | Error | Alarm Reset | | |
|--------|---------|---------------------------|-----------------|-----------------|-----------------|------------------------------|---------------------|----|--|
| | | ACD3 (Bit 3) | ACD2 (Bit 2) | ACD1 (Bit 1) | ACD0 (Bit 0) | | Power Supply OFF | ON | MR- Configurator/ HMI ⁽³⁾ |
| Alarms | A52 | 0 | 1 | 0 | 1 | Excessive discrepancy error | ✓ | ✓ | ✓ |
| | A61 | 0 | 1 | 0 | 1 | Operation alarm | ✓ | ✓ | ✓ |
| | A8A | 0 | 0 | 0 | 0 | Serial communication timeout | ✓ | ✓ | ✓ |
| | A8E | 0 | 0 | 0 | 0 | Serial communication error | ✓ | ✓ | ✓ |
| | 888 | 0 | — | — | — | Watchdog | ✓ | — | — |

Table A-3: Error messages (2)

⁽¹⁾ Locate and correct the cause of the error and allow the servo amplifier, the servo motor and the regenerative braking unit to cool down for at least 30 minutes before resetting the alarm and restarting the system for normal operation.

⁽²⁾ Switch on the RES signal.

⁽³⁾ To reset the alarm click on the Alarm Reset button in the alarm display window in MR Configurator. You can also reset the alarm by pressing the STOP/RESET button on the HMI control unit.

⁽⁴⁾ 0: OFF

1: ON

NOTE

The output signal ALM is activated when an error or alarm signal is triggered.

| | Display | Warning |
|------------------|---------|--------------------------------------|
| Warning messages | A90 | Home position return incomplete |
| | A92 | Battery cable disconnected |
| | A96 | Home position return error |
| | A98 | Software limit warning |
| | A99 | Stroke limit warning |
| | A9A | Option unit input data error |
| | A9F | Battery warning |
| | AE0 | Regenerative system overload warning |
| | AE1 | Overload warning 1 |
| | AE3 | Absolute position counter error |
| | AE6 | Server emergency off warning |
| | AE8 | Cooling fan too slow |
| | AE9 | Main circuit off |
| | AEC | Overload warning 2 |
| | AED | Output wattage exceeded |

Table A-4:
Warning messages**NOTE**

Please see the instruction manual for more detailed descriptions of the alarm messages and warnings.

Index

A

- Alarm messages
 - List A - 41
- Automatic input signal activation
 - Turning off. 4 - 14

C

- CC-Link communications
 - Settings 5 - 34
- Connections
 - Minimum connections 3 - 5
- Creep speed 4 - 15

D

- DOG home position return 4 - 19
- Digital signals
 - Quick reference. A - 39

E

- Expansion card MR-J3-D01
 - Installation 2 - 3
 - Settings 4 - 23

F

- Functional test 3 - 5
 - CC-Link 5 - 38
 - Positioning with digital inputs 4 - 28
 - Settings. 3 - 7

G

- GX IEC Developer
 - Data communications. 5 - 38

H

- Home position return 4 - 15

I

- Installation
 - Hardware 2 - 3

M

- MR Configurator
 - functional check. 3 - 10
- Minimum connections 3 - 5

P

- Parameter
 - Quick reference. 4 - 21
- Pin assignments 3 - 6
- Point table
 - configuring 3 - 9
- Point table positioning 4 - 11
 - Preparations 1 - 1
- Positioning
 - Settings 4 - 23
 - via a CC-Link network. 5 - 31
 - with digital inputs 4 - 11

Positioning table

- exporting 4 - 26
- importing 4 - 26

Positioning table entries

- selecting. 3 - 10

S

- Servo amplifier
 - selecting 3 - 7
- Signal assignments
 - Connectors CN6 and CN10. 4 - 12

Standard parameters

- Quick reference. A - 40

W

- Warning messages
 - Reference list A - 42

Z

- Z-phase reference
 - without DOG signal 4 - 15

| HEADQUARTERS | | EUROPEAN REPRESENTATIVES | | EUROPEAN REPRESENTATIVES | | EURASIAN REPRESENTATIVES | |
|---|--------|---|------------------------|--|-------------|---|------------|
| MITSUBISHI ELECTRIC EUROPE B.V. German Branch Gothaer Straße 8 D-40880 Ratingen Phone: +49 (0)2102 / 486-0 Fax: +49 (0)2102 / 486-1120 | EUROPE | GEVA Wiener Straße 89 AT-2500 Baden Phone: +43 (0)2252 / 85 55 20 Fax: +43 (0)2252 / 488 60 | AUSTRIA | ALFATRADE Ltd. 99, Paola Hill Malta- Paola PLA 1702 Phone: +356 (0)21 / 697 816 Fax: +356 (0)21 / 697 817 | MALTA | Kazpromautomatics Ltd. Mustafina Str. 7/2 KAZ-470046 Karaganda Phone: +7 7212 / 50 11 50 Fax: +7 7212 / 50 11 50 | KAZAKHSTAN |
| MITSUBISHI ELECTRIC EUROPE B.V. CZECH REPUBLIC Czech Branch Avenir Business Park, Radlická 714/113a CZ-158 00 Praha 5 Phone: +420 - 251 551 470 Fax: +420 - 251-551-471 | | TEHNIKON Oktyabrskaya 16/5, Off. 703-711 BY-220030 Minsk Phone: +375 (0)17 / 210 46 26 Fax: +375 (0)17 / 210 46 26 | BELARUS | INTEHSIS srl bld. Traian 23/1 MD-2060 Kishinev Phone: +373 (0)22 / 66 4242 Fax: +373 (0)22 / 66 4280 | MOLDOVA | SHERF Motion Techn. Ltd. Rehov Hamerkava 19 IL-58851 Holon Phone: +972 (0)3 / 559 54 62 Fax: +972 (0)3 / 556 01 82 | ISRAEL |
| MITSUBISHI ELECTRIC EUROPE B.V. FRANCE French Branch 25, Boulevard des Bouvets F-92741 Nanterre Cedex Phone: +33 (0)1 / 55 68 55 68 Fax: +33 (0)1 / 55 68 57 57 | | ESCO DRIVES & AUTOMATION Culliganlaan 3 BE-1831 Diegem Phone: +32 (0)2 / 717 64 30 Fax: +32 (0)2 / 717 64 31 | BELGIUM | HIFLEX AUTOM.TECHNIK B.V. Wolveverstraat 22 NL-2984 CD Ridderkerk Phone: +31 (0)180 - 46 60 04 Fax: +31 (0)180 - 44 23 55 | NETHERLANDS | CEG INTERNATIONAL Cebaco Center/Block A Autostrade DORA Lebanon - Beirut Phone: +961 (0)1 / 240 430 Fax: +961 (0)1 / 240 438 | LEBANON |
| MITSUBISHI ELECTRIC EUROPE B.V. IRELAND Irish Branch Westgate Business Park, Ballymount IRL-Dublin 24 Phone: +353 (0)1 4198800 Fax: +353 (0)1 4198890 | | Koning & Hartman b.v. Woluweelaan 31 BE-1800 Vilvoorde Phone: +32 (0)2 / 257 02 40 Fax: +32 (0)2 / 257 02 49 | BELGIUM | Koning & Hartman b.v. Haarlerbergweg 21-23 NL-1101 CH Amsterdam Phone: +31 (0)20 / 587 76 00 Fax: +31 (0)20 / 587 76 05 | NETHERLANDS | | |
| MITSUBISHI ELECTRIC EUROPE B.V. ITALY Italian Branch Viale Colleoni 7 I-20041 Agrate Brianza (MB) Phone: +39 039 / 60 53 1 Fax: +39 039 / 60 53 312 | | INEA BH d.o.o. Aleja Lipa 56 BA-7100 Sarajevo Phone: +387 (0)33 / 921 164 Fax: +387 (0)33 / 524 539 | BOSNIA AND HERZEGOVINA | Beijer Electronics AS Postboks 487 NO-3002 Drammen Phone: +47 (0)32 / 24 30 00 Fax: +47 (0)32 / 84 85 77 | NORWAY | SHERF Motion Techn. Ltd. Rehov Hamerkava 19 IL-58851 Holon Phone: +972 (0)3 / 559 54 62 Fax: +972 (0)3 / 556 01 82 | ISRAEL |
| MITSUBISHI ELECTRIC EUROPE B.V. POLAND Poland Branch Krakowska 50 PL-32-083 Balice Phone: +48 (0)12 / 630 47 00 Fax: +48 (0)12 / 630 47 01 | | AKHNATON 4 Andrej Ljapchev Blvd. Pb 21 BG-1756 Sofia Phone: +359 (0)2 / 817 6004 Fax: +359 (0)2 / 97 44 06 1 | BULGARIA | Sirius Trading & Services srl Aleea Lacul Morii Nr. 3 RO-060841 Bucuresti, Sector 6 Phone: +40 (0)21 / 430 40 06 Fax: +40 (0)21 / 430 40 02 | ROMANIA | CEG INTERNATIONAL Cebaco Center/Block A Autostrade DORA Lebanon - Beirut Phone: +961 (0)1 / 240 430 Fax: +961 (0)1 / 240 438 | LEBANON |
| MITSUBISHI ELECTRIC EUROPE B.V. SPAIN Spanish Branch Carretera de Rubí 76-80 E-08190 Sant Cugat del Vallés (Barcelona) Phone: 902 131121 // +34 935653131 Fax: +34 935891579 | | INEA CR d.o.o. Losinjska 4 a HR-10000 Zagreb Phone: +385 (0)1 / 36 940 - 01 / -02 / -03 Fax: +385 (0)1 / 36 940 - 03 | CROATIA | Craft Con. & Engineering d.o.o. Bulevar Svetog Cara Konstantina 80-86 SER-18106 Niš Phone: +381 (0)18 / 292-24-4/5 Fax: +381 (0)18 / 292-24-4/5 | SERBIA | | |
| MITSUBISHI ELECTRIC EUROPE B.V. UK UK Branch Travellers Lane UK-Hatfield, Herts. AL10 8XB Phone: +44 (0)1707 / 27 61 00 Fax: +44 (0)1707 / 27 86 95 | | AutoCont C.S. s.r.o. Technologická 374/6 CZ-708 00 Ostrava-Pustkovec Phone: +420 595 691 150 Fax: +420 595 691 199 | CZECH REPUBLIC | INEA SR d.o.o. Izletnicka 10 SER-113000 Smederevo Phone: +381 (0)26 / 617 163 Fax: +381 (0)26 / 617 163 | SERBIA | | |
| MITSUBISHI ELECTRIC CORPORATION JAPAN Office Tower "Z" 14 F 8-12, 1 chome, Harumi Chuo-Ku Tokyo 104-6212 Phone: +81 3 622 160 60 Fax: +81 3 622 160 75 | | B:ELECTRIC, s.r.o. Mladoboleslavská 812 CZ-197 00 Praha 19 - Kbely Phone: +420 286 850 848, +420 724 317 975 Fax: +420 286 850 850 | CZECH REPUBLIC | AutoCont Control s.r.o. Radlinského 47 SK-02601 Dolny Kubin Phone: +421 (0)43 / 5868210 Fax: +421 (0)43 / 5868210 | SLOVAKIA | | |
| MITSUBISHI ELECTRIC AUTOMATION, Inc. USA 500 Corporate Woods Parkway Vernon Hills, IL 60061 Phone: +1 847 478 21 00 Fax: +1 847 478 22 53 | | Beijer Electronics A/S Lykkegrædsvej 17 DK-4000 Roskilde Phone: +45 (0)46 / 75 76 66 Fax: +45 (0)46 / 75 56 26 | DENMARK | CS MTrade Slovensko, s.r.o. Vajanskeho 58 SK-92101 Piestany Phone: +421 (0)33 / 7742 760 Fax: +421 (0)33 / 7735 144 | SLOVAKIA | | |
| | | Beijer Electronics Eesti OÜ Pärnu mnt.160i EE-11317 Tallinn Phone: +372 (0)6 / 51 81 40 Fax: +372 (0)6 / 51 81 49 | ESTONIA | INEA d.o.o. Stegne 11 SI-1000 Ljubljana Phone: +386 (0)1 / 513 8100 Fax: +386 (0)1 / 513 8170 | SLOVENIA | | |
| | | Beijer Electronics OY Peltokie 37 FIN-28400 Ulvila Phone: +358 (0)207 / 463 540 Fax: +358 (0)207 / 463 541 | FINLAND | Beijer Electronics AB Box 426 SE-20124 Malmö Phone: +46 (0)40 / 35 86 00 Fax: +46 (0)40 / 93 23 01 | SWEDEN | | |
| | | UTECO A.B.E.E. 5, Mavrogenous Str. GR-18542 Piraeus Phone: +30 211 / 1206 900 Fax: +30 211 / 1206 999 | GREECE | Omni Ray AG Im Schörl 5 CH-8600 Dübendorf Phone: +41 (0)44 / 802 28 80 Fax: +41 (0)44 / 802 28 28 | SWITZERLAND | | |
| | | MELTRADE Kft. Ferő utca 14. HU-1107 Budapest Phone: +36 (0)1 / 431-9726 Fax: +36 (0)1 / 431-9727 | HUNGARY | GTS Bayraktar Bulvari Nutuk Sok. No:5 TR-34775 Yukari Dudullu-Ümraniye-İSTANBUL Phone: +90 (0)216 526 39 90 Fax: +90 (0)216 526 3995 | TURKEY | | |
| | | Beijer Electronics SIA Ritausmas iela 23 LV-1058 Riga Phone: +371 (0)784 / 2280 Fax: +371 (0)784 / 2281 | LATVIA | CSC Automation Ltd. 4-B, M. Raskovoyi St. UA-02660 Kiev Phone: +380 (0)44 / 494 33 55 Fax: +380 (0)44 / 494-33-66 | UKRAINE | | |
| | | Beijer Electronics UAB Savanoriu Pr. 187 LT-02300 Vilnius Phone: +370 (0)5 / 232 3101 Fax: +370 (0)5 / 232 2980 | LITHUANIA | | | | |